

340,000 Rebuild

S/N 855083

6/8/2021

R-15

Service Records Indicate Motor Rebuilt 9/27/2007 At Cascade Diesel In North Bend. Unable To Locate Receipt. Mileage At Rebuild 344,077. Miles On New Motor 466,267.

Please Note Odometer Had Been Replaced At 403,249. Current Odometer Reading 407,095 Total Truck Miles 810,344

CUSTOMER INVOICE

\*\*\*\*\*  
 \* WESTERN PETERBILT, INC.  
 \* P.O. BOX 24065  
 \* SEATTLE, WA 98124  
 \*  
 \*\*\*\*\*

INVOICE DATE 06-19-12

\*\*\*\*\*  
 \* CUSTOMER NAME  
 \* RED E TRUCKING  
 \* 18816 NE 80TH ST.  
 \* REDMOND, WA 98053  
 \*  
 \*\*\*\*\*  
 \* NUMBER 18005  
 \* PHONE 425 868-0270  
 \* P.O. NO. R15  
 \* COMPLETE 06-16-12  
 \*  
 \*\*\*\*\*  
 \* REPAIR ORDER NUMBER  
 \* >>>> SE26001 <<<<<

OPEN 06-13-12  
 SVC WTR sh \*RK

SERIAL NO. 1NKDXBOX2YR855083 UNIT NO. R15  
 YEAR/MAKE/MODEL - 2000 KENWORTH T800B  
 ENGINE/MODEL/SERL  
 TRNS/MODEL/SERL -  
 RXLS MODEL/SERL -  
 SELL DLR

MILEAGE 108187  
 LICENSE A63996F  
 CPL/ARRG  
 R RATIO  
 TAG #  
 DEL MILE

DEL DATE

1 CUSTOMER REQUEST REPLACE CLUTCH AND REAR MAIN SEAL  
 REMOVED DRIVE LINE CROSSMEMBER, PTO PUMP, DRAINED OIL, REMOVED SHIFT  
 TOWER, CROSSMEMBER AT TRANNY SUPPORT BRACKET, AIR LINES, LINKAGE,  
 TRANNY BOLTS, CLUTCH, FLYWHEEL, REAR MAIN SEAL. REMOVED TRANNY FROM  
 UNDER TRUCK. STARTED REMOVING YOKE, BUT TONE RING WAS STUCK HAD TO USE  
 HEAT TO REMOVE AND BREAK LOOSE. INSTALLED REAR MAIN SEAL AND FLYWHEEL.  
 RAN TRUCK AND CHECKED FOR LEAKS NONE FOOUND. INSTALLED CLUTCH, SWAPPED  
 PARTS FROM OLD TRANNY TO NEW TRANNY. INSTALLED TRANSMSSION AND  
 TIGHTENED ALL BOLTS. CLEAN PTO HAD ABOUT 1 INCH DIRT BUILDUP. INSTALL  
 BELL HOUSING BOLT PULL TRANNY BACK AND GET FORKS INTO CORRECT  
 POSITION. INSTALL BELL HOUSING, PTO ALL WIRES, BEELY STRAP,  
 ADJUST LINKAGE FILL WITH OIL. INSTALL DRIVE LINE AND SHAFT. SHIM AND  
 INSTALL PTO, INSTALL SHIFTER AND CONNECT AIR LINES, WIRES FOR LIFT  
 AXLE AND BOX CONTROLS. ROADTEST, READJUST CLUTCH AND INSPECT FOR  
 LEAKS.

TOTAL LABOR \$2,127.50  
 TOTAL PARTS \$5,684.52  
 TOTAL CONSUMABLE \$140.48

1	6306LLUUA1C3/2E	BEARING	\$12.09
1	BK313	BRAKE ASS	\$26.19
1	208925-82	CLUTCH-15	\$649.99
1	1425868	SEAL GP-C	\$68.59
2	734-20	BRAKE CLN	\$5.18
20	CT05317	TIE-CABLE	\$3.80
1	4305294	GASKET-SH	\$3.69
1	K2918	KIT-OIL S	\$26.49
1	CP105C137	FORK-CLUT	\$16.49
	B/O RELEASE SEE565315	CONFIRM # 115704	
1	RTL018918B	TRANS	\$4,350.00
	B/O RELEASE SEE565350	CONFIRM # 115765	
8	009-109-1	GR8 BOLT	\$3.28

SEE56531

SEE56535

CONTINUED

INVOICE DATE 06-19-12

\*\*\*\*\*  
\* WESTERN PETERBILT, INC.  
\* P.O. BOX 24065  
\* SEATTLE, WA 98124  
\*  
\*\*\*\*\*

CUSTOMER NAME  
RED E TRUCKING  
NUMBER 18005  
PHONE 425 868-0270  
REPAIR ORDER NUMBER  
>>>> SE26001 <<<<<

SEE56535 8 072-204-1 GR8 BOLT \$0.48  
B/O RELEASE SEE565355 CONFIRM # 115773  
1 K3966 KIT-HEAT \$360.59  
SN FOR TRANS 100182  
4 FG3987 FITTING-S \$49.16  
6 CT05317 TIE-CABLE \$1.14  
10 GDR1/2R5 HOSE \$50.60  
2 VL2044 VALVE-TRU \$40.02  
2 35P15-1 GASKET-HO \$1.38  
2 35P15-2 GASKET-HO \$1.78  
2 6.5-70-18X25 KIT-STRAP \$13.58  
32 98HL92 FLUID-TRA \$140.48

2 \*\* SERV FLYWHEEL RESURF SERVICE SPECIAL \*\*  
SERVICE FLYWHEEL RESURFACE  
SERVICE FLYWHEEL. SERVICE SPECIAL \$99.00

3 INSTALL NEW TRANS COOLER.  
MAKE NEW COOLING LINES AND MAKE NEW LINES. INSTALL FITTINGS ON COOLING  
SIDE. INSTALL NEW TRANS COOLER.  
TOTAL PARTS \$49.39

4 HE3625 HOSE-HEAT \$17.96  
7 HE3625 HOSE-HEAT \$31.43

MISCELLANEOUS SUPPLIES \$106.38  
ENVIRONMENTAL COMP CHR \$314.46

SHOP LABOR- RETAIL 410C.21 \$2,127.50  
SHOP PARTS- RETAIL 410P.21 \$5,874.39  
QUICK-LUBE - RETAIL 415C.21 \$99.00  
SUPPLIES - RTL 776C.21 \$420.84  
SALES TAX 229W.21 \$809.56  
PLEASE PAY THIS TOTAL 110R.20 \$9,331.29

WESTERN PETERBILT'S SEATTLE SERVICE DEPARTMENT THANKS YOU FOR  
YOUR BUSINESS. IF YOU HAVE ANY QUESTIONS OR CONCERNS REGARDING  
THE WORK PERFORMED, OR THIS BILLING PLEASE FEEL FREE TO CONTACT  
US AT (206) 624-7383.  
PLEASE REFER TO THE COVER SHEET TO THIS BILLING FOR WARRANTY AND  
PAYMENT TERMS INFORMATION.