

**Charles Moore** 

**Duke's Truck Repair** 

2401 Airport Way South Seattle, WA. 98134

Phone: 206-623-1394 Fax: 206-623-8643

INVOICE

18374

Ref #: 47284 Printed Date: 09/30/2021 Work Completed: 09/29/2021

1995 Ford - F Series - F700 - Ford 7.0L 99J 8 CYL

Lic #: Odometer In: 28563

				LIG # .	Odomoto in	. 20000
Cell 206-414-9223			VIN #: 1FDXF70J3 <b>SVA12398</b>			
Part Description	Qty	Sale	Ext	Labor Description	Hours	Ext
Fuel Pump - Electric In-Tank Type Filter (Gold) Fuel Pump Strainer	1.00 1.00 1.00	129.72 6.39 20.73	6.39 20.73	Sanitized	3.00	405.00
Gasket Sealant	1.00	13.79	13.79			
Transmission Rebuild	1.00	4,875.00	4,875.00			
Syn 5 Gallon Trans Fluid Shop Supplies	0.50	374.91	Check firing order#3 & #6 are in wrong place. Need to road to duplicate sputter/lower power and then swap #3 & #6 wires at and see if symptom improves or is resolved Road test up 509confirm low power/sputter. Stop to swap #3 wires on distributor. Continue to driveno further sputter but st power, have to accelerate slowly/hard down shift/have to feath pedal to up shift. Return to shop Scan with computerno codes Check TPSgood Road testlower power gradually increases with operating tem Suspect exhaust restriction or lower fuel pressure. Need to let & check fuel pressure Connect fuel pressure gauge & road testspec running is 30-45PSI, when low power concern arises, pressure drops as as 5PSI.  *Needs fuel pump & filter* Fuel level sending unit not connected to any wiring. Suspect w gauge inoperable, found wire, no power to wire, no power to coolant temp sender or oil pressure. No power at these indicat failed instrument cluster. **will need cluster sent out for rebuild Shops A/C machine out for repairs so unable to address this is at this time			
				Disassemble Remove & replace fuel pump Remove & replace fuel pump strainer Remove & fuel filter Road test  Cluster will have to be rebuilt as it did not come a individual pieces and they are obsolete. Rebuild approximately \$500. The shop that rebuil this time reopening after Sept 13thl It would more take time and expense to install aft for customer and not guaranteed to work  Still need to do overall inspection. Will perform whereplaced  Courtesy discount 1.75 hrs of fuel pump	ds is closed at ermarket gauges	742.50 -236.25
				replacement  Moving truck went into limp mode and lost forward gears. Needs transmission rebuilt.  Customer approved repair	13.00	1,755.00

Visit us on the web: www.dukestruckrepair.com



## **Duke's Truck Repair**

2401 Airport Way South Seattle, WA. 98134

Phone: 206-623-1394 Fax: 206-623-8643

INVOICE

18374

Ref #: 47284 Printed Date: 09/30/2021 Work Completed: 09/29/2021

Charles Moore 1995 Ford - F Series - F700 - Ford 7.0L 99J 8 CYL

Lic#: Odometer In: 28563

Cell 206-414-9223 VIN #: 1FDXF70J3 **SVA12398** 

Hours **Part Description** Qty Sale **Ext Labor Description** Ext Disassemble--found dip stick tube broken Remove transmission Rebuild transmission Install rebuilt transmission with new dipstick tube Reassemble Add fluid Road test--runs good, shifts well up/down, good fuel pump -5.00 -675.00 Courtesy discount 5 hrs labor on transmission rebuild **Environmental Charge** 20.00

[Payments - ]

Vehicle Received: 8/25/2021

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

TEAR DOWN ESTIMATE: I understand that my vehicle will be reassembled within \_\_2 \_\_days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts \_\_.

Duke's Truck Repair has a 6 month Labor and 1 Year Parts Warranty. We are not responsible for lost, stolen or damaged property in the cab or on the truck while doing repairs.

Parts: 5,248.09

HazMat: 20.00

Sub: 7,259.34

Tax: 744.08

Total: \$8,003.42

Bal Due: \$8,003.42

1.991.25

Customer Number : 2171

Signature \_\_\_\_\_ Date\_\_\_\_

Service Advisor: Combs, Lisa, Tech: Please Select, Technician; Knowles, Kevin

Labor: