

9803



MACHINERY

Order John Deere Parts & View Invoices at customerportal.pape.com

| | |
|--------------|-------------|
| INVOICE DATE | INVOICE NO. |
| * 3-06-23 | 4108664 |




JOHN DEERE

9803 - 2276

SERVICE INVOICE

Papé Machinery, Inc., PO Box 10527, Eugene, OR 97440

This sale is subject to Papé's Terms and Conditions of Sale effective on the date hereof, which are incorporated in full by this reference. The Terms and Conditions of Sale are available at www.pape.com/terms, and will also be sent by mail or e-mail to the purchaser upon request.

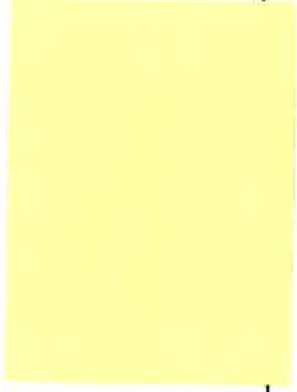

S
H
I
P
T
O

4105
1

FAR

FAR

296 PHONE: 425-268-3289

8296

| | | | |
|----------|-------------------|--------------------|-------|
| CUSTOMER | DATE OPENED | PURCHASE ORDER NO. | METER |
| JD | 2-17-23 | | 1698 |
| MAKE | SERIAL NO. | EQUIP. NO. | |
| XUV550S4 | 1M0550FBHCM012625 | | |

| QUANTITY | DESCRIPTION | EACH | AMOUNT |
|-------------|--|----------|----------|
| SEGMENT 001 | SHIFTER DOESN'T WORK, STUCK IN REVERSE PLEASE FIND SERIAL # FOR MACHINE IF POSSIBLE ***** TECHNICIAN FOUND THAT THE TRANSMISSION HAD INTERNAL DAMAGE THAT IS CAUSING THE SHIFTER TO CLASH BUT NOT WORK. AFTER CONSULTING WITH THE CUSTOMER CUSTOMER DECIDED TO REPLACE THE TRANSMISSION IN ITS ENTIRETY. TECHNICIAN HAD TO REMOVE ALL REAR PLASTIC COMPONENTS, AIR FILTER BOX ASSEMBLY, EXHAUST SHIELDS, DRIVE CLUTCH COVERS, DRIVE BELT, BOTH DRIVE CLUTCHES, COVER BACKING PLATE, DRAINED TRANSMISSION, REMOVED BOTH CV AXLES, BOTH AXLES WHERE WELL SEIZED INTO THE TRANSMISSION. REMOVE BACK SHOCKS AND TOP CONTROL ARM, AND BRAKE ROTORS TO REMOVE AXLES, REMOVED HARNESS AND ALL LINKAGES TO THE TRANSMISSION INCLUDING CABLES, AND REMOVED TRANSMISSION, INSTALLED PROPER SEALS AND COVER FOR THE AXLES, INSTALLED TRANSMISSION IN REVERSE ORDER AND TEST DROVE THE MACHINE. | | |
| 1 | 40M7046 SNAP RING | 4.96 | 4.96 |
| 1 | M163607 SEAL | 8.25 | 8.25 |
| 1 | M168149 SEAL | 10.20 | 10.20 |
| 1 | M168958 COVER | 114.30 | 114.30 |
| 1 | MIA13019 TRANSAXLE | 4,141.49 | 4,141.49 |
| 1 | R61467 O-RING | 4.46 | 4.46 |
| 3 | TY22035 QT LOW VISC@ | 6.81 | 20.43 |
| | PARTS | | |
| | LABOR | | |
| | 4,304.09 | | |
| | 1,411.60 | | |
| SEGMENT 002 | NO POWER WITH ENGINE-RUNS BUT HAS A LACK OF POWER ***** TECHNICIAN NOTICED MACHINE WAS LACKING POWER AND RUNNING RICH. CALLED CUSTOMER AND CUSTOMER APPROVED REPLACEMENT OF | | |
| | SEGMENT TOTAL--> | | 5,715.69 |

| DESCRIPTION | AMOUNT |
|--|--------|
| TOTAL PARTS | |
| TOTAL LABOR | |
| SPECIAL SERVICES | |
| SUBMIT PAYMENTS ONLY TO: | |
| Papé Machinery | |
| PO Box 35144 #5077 | |
| Seattle, WA 98124-5144 | |
| <i>Payment should be by cash, check or ACH/wire transfer</i> | |



MACHINERY

Papé Machinery, Inc., PO Box 10527, Eugene, OR 97140

Order John Deere Parts & View Invoices at customerportal.pape.com

INVOICE DATE 3-06-23 INVOICE NO. 4108664



JOHN DEERE

SERVICE INVOICE

This sale is subject to Papé's Terms and Conditions of Sale effective on the date hereof, which are incorporated in full by this reference. The Terms and Conditions of Sale are available at www.pape.com/terms, and will also be sent by mail or e-mail to the purchaser upon request.

FAR 8296 SHIP TO 4105 2

F. FAR

18296

PHONE: 425-268-3289

Table with columns: CUSTO, MAKE, JD, QUANTITY, DESCRIPTION, EACH, AMOUNT. Includes purchase order details, equipment info, and a detailed list of parts and labor with their respective amounts.

Payment should be by cash, check or ACH/wire transfer

SUBMIT PAYMENTS ONLY TO:

Papé Machinery PO Box 35144 #5077 Seattle, WA 98124-5144

TERMS: PAYMENT DUE 03/16/23

www.papemachinery.com

STATE/LOCAL TAX PLEASE PAY THIS TOTAL

TOTAL PARTS 4,740.50 TOTAL LABOR 2,147.20 SPECIAL SERVICES STATE/LOCAL TAX .00 PLEASE PAY THIS TOTAL 6,887.70