

#### SERVICE DEPARTMENT HOURS:

7:00 AM - 6:00 PM MONDAY—FRIDAY

PO BOX 217 • 526 ROOSEVELT AVE • ENUMCLAW, WA 98022

PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

026211. PIT 010AL

#### SO # 471125

Status Printed Comeback

01/23/2023 8:20:31 AM

## SERVICE ORDER

User

058

Page

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

J.R. HAYES AND SONS INC

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home Cell

(425) 392-5722 Bus (206) 379-7054 Today

Email

mandrosko@irhayes.com

**Term CHARGE** 

CUSTOMER COPY

B353 Advisor Dixie Thompson Promised 01/23/2023 6:00 PM Tag 01/19/2023 1:49 PM Shop Opened Location 1.23 PO# Х **Priority** 40 Cashiered

License No

Odometer In

**Odometer Out** 181536

InServ Date

Stock No

C80157J Year Make

Vehicle ID No

2017

181534

Model

Selling Dealer

Shp

1

**Model No** 

Color

RACE RED F1F **Delivery Date Extended Warranty** 

Job

1FTMF1EP1HKD60387

**FORD** 

**Engine Size** 2.7L V6 ECOBOOST Fleet # P117

**CSR Status** 

Request **ENGINE** 

Description CUSTOMER STATES WHEN YOU GIVE IT THROTTLE IT FEELS LIKE THE ENGINE IS GOING 058 Original

F-150

TO FALL OUT, CHECK AND ADVISE

Labor **ENGINE** 

Cause

Description CUSTOMER STATES WHEN YOU GIVE IT THROTTLE IT FEELS LIKE THE ENGINE IS GOING TO FALL OUT,

Type CF

Amount 326.34

Part

CHECK AND ADVISE

Price Type Retail

264.27

326.34

590.61

GB8Z 9E926 A

THROTTLE BODY AND MOTOR ASY

**CRO15** Parts Total

Request Sub-total

Bin

Labor Total

Amount 310.91 264.27 264.27

Technician

Correction

082 -CUSTOMER STATES WHEN YOU GIVE IT THROTTLE IT FEELS LIKE THE

ENGINE IS GOING TO FALL OUT, CHECK AND ADVISE

145648

HAD CODE P2112 FOR THROTTLE BODY STUCK CLOSED FOLLOWED PIN POINT TEST FOR DTC AND THE RESULT OF THE PIN POINT TEST WANTS

US TO REPLACE THROTTL BODY, P/A PARTS AND LET DIXIE KNOW REPLACED THROTTLE BODY, CLEARED CODES AND RESET KAM AND

TEST DROVE TO VERIFIY PROPER OPERATION

Description

326.34 Labor 264.27 Parts Supplies 29.53 (48.95)Discount SUB-TOTAL 571.19 50.26

TOTAL INVOICE

621.45

#### TERMS CASH: UNLESS ARRANGEMENTS MADE, LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

5	ie	na	h	ar	ρ



#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY-FRIDAY

PO BOX 217 • 526 ROOSEVELT AVE • ENUMCLAW, WA 98022

PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### SO # 468827

### SERVICE ORDER **CUSTOMER COPY**

B086

10.31

Х

Stock No

Printed

10/31/2022 10:14:21 AM

Opened

Cashiered

Dixie Thompson Promised

Odometer in

175447

058 Page User

Tag

PO#

Job

Location

**Customer No** Attn: MIKE ANDROSKO 206 379 7054 J.R. HAYES AND SONS INC

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home Cell Email

(425) 392-5722 Bus (206) 379-7054 Today

mandrosko@jrhayes.com

Description

**Term CHARGE** 

License No C80157J Make Year 2017 FORD

Vehicle ID No

Advisor

**Priority** 

Shop

145648

Model F-150

**Selling Dealer** 

175460

**Odometer Out** 

Model No F<sub>1</sub>E **Extended Warranty** 

**InServ Date** 

10/31/2022 6:00 PM

10/31/2022 6:50 AM

Color RACE RED **Delivery Date** 

**Type** 

1F

1FTMF1EP1HKD60387

S2

10

**Engine Size** 2.7L V6 ECOBOOST Fleet # P117

**CSR Status** 058 Original

Amount

0.00

0.00

0.00

0.00

Request **TRANS** 

CUSTOMER STATES THAT THE TRANNY GETS STUCK IN 4TH, HE PUSHES THE GAS AND IT

GOES INTO THIRD AND RAPS OUT, HE WILL LET OFF THE GAS AND IT WILL SHIFT UP TO

6TH.

Labor **TRANS**  Description CUSTOMER STATES THAT THE TRANNY GETS STUCK IN 4TH, HE PUSHES THE GAS AND IT GOES INTO

THIRD AND RAPS OUT, HE WILL LET OFF THE GAS AND IT WILL SHIFT UP TO 6TH. Parts Total

Technician Cause

Correction

TEST DROVE AND VERIFIED CONCERN AND WRENCH LIGHT CHECKED

FOR CODES AND FOUND AN UNDERBOOST CODES INSPECT AND FOUND A CAC TUBE LOOSE SECURED THE CAC TUBE AND TEST DROVE OK

NO CHARGE FOR GOODWILL SINCE VEHICLE WAS JUST HERE

Labor Total 0.00 **Request Sub-total** 

Labor **Parts** Supplies SUB-TOTAL

0.00 0.00 0.00

Tax TOTAL INVOICE

0.00

#### TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores-Must have original invoice and be in factory package. Restock fee is 25%.

Signature	

l é

# FUGATE FORD


#### SERVICE DEPARTMENT HOURS:

7:00 AM - 6:00 PM MONDAY-FRIDAY

PO BOX 217 • 526 ROOSEVELT AVE • ENUMCLAW, WA 98022

PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM



#### SO # 468739

Printed

Request

**ENGINE** 

**ENGINE** 

HL3Z 19703 K

HL3Z 19849 D

Labor

Part

## CUSTOMER COPY

CUSTOMER STATES THE ENGINE FAN IS ON HIGH ALL THE TIME, CHECK AND ADVISE

CUSTOMER STATES THE ENGINE FAN IS ON HIGH ALL THE TIME, CHECK AND ADVISE

VALVE ASY - EVAPORATOR EXPANSI

058 Page User

Job

**Type** 

W

Bin

112

1

**CSR** 

058

WF

**Type** 

**Price** 

Status

Original

**Amount** 

**Amount** 

145648 **Customer No** Attn: MIKE ANDROSKO 206 379 7054 J.R. HAYES AND SONS INC 22430 SE 231 ST MAPLE VALLEY, WA 98038

10/28/2022 3:16:44 PM

(425) 392-5722 Bus Home (206) 379-7054 Today Cell mandrosko@jrhayes.com Email

Description

Description

**Term CHARGE** 

Description

COMPRESSOR ASY

B079 10/27/2022 6:00 PM Tag Advisor Dixie Thompson Promised 10/27/2022 6:48 AM 10.28 Location Shop Opened S<sub>2</sub> PO# Х 20 Cashiered **Priority** 

Stock No **Odometer In Odometer Out InServ Date** License No 175351 175355 C80157J Color Model Model No Year Make RACE RED F-150 F1E 2017 **FORD Extended Warranty Delivery Date** Selling Dealer Vehicle ID No 1FTMF1EP1HKD60387 Fleet # P117 2.7L V6 ECOBOOST **Engine Size** 

Shp

1

1

20 U201 W **REFRIGERANT - R-134A** YN 19 0.00 Parts Total Technician 0.00 CHECKE DOPERATION OF ENGINE COOLING FANS. RUN ON HIGH. Labor Total Cause TESTED AND DIAG. FANS AND AC SYSTEM. AC SYSTEM PRESSURES ARE 0.00 Request Sub-total TOO HIGH AND FANS ARE ON HIGH TO TRY AND GET PRESSURES DOWN. NEEDS AC COMPRESSOR AND TXV VAVLE RECOVERED FREEON, REPLACED AC COMPRESSOR AND TXV VALVE. Correction EVAC AND REWCHARGED AC SYSYTEM. RD TEST. FAN IS NOT ON HIGH ANYMORE. **CSR** Status Job Request Description 2 058 Original PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP **WRKS** TO 6 QTS \$3.20 ADDL QTS Type **Amount** Description Labor CF 39.45 PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP TO 6 QTS WRKS \$3.20 ADDL QTS Price Amount Shp Bin Type Description Part LB0 CRO 9.31 9.31 FILTER ASY - OIL FL 2062 A 21.60 6 **BULK** CRO 3.60 OIL - ENGINE XO 5W30 BSP 30.91 Parts Total Technician 39.45 PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT Labor Total Cause INSPECTION - UP TO 6 QTS \$3.20 ADDL QTS 70.36 Request Sub-total LOF, MPI, ROTATED TIRES, CHECKED PSI. Correction CSR Status Job Description Request 058 Original SHUTTLE - TRANSPORT CUSTOMER TO LOCATION OF THEIR CHOICE WITH IN LOCAL AREA 3 SHU

TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Signature		



# **FUGATE FORD**

#### SERVICE DEPARTMENT HOURS:

7:00 AM - 6:00 PM MONDAY-FRIDAY

PO BOX 217 • 526 ROOSEVELT AVE • ENUMCLAW, WA 98022

PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### SO # 468739

#### SERVICE ORDER CUSTOMER COPY

**Printed** 

10/28/2022 3:16:44 PM

Advisor

**Priority** 

User

058

Page

**Customer No** 

145648

Dixie Thompson Promised Shop S2 Opened

10/27/2022 6:00 PM 10/27/2022 6:48 AM

B079 Taq Location 10.28 PO# Х

J.R. HAYES AND SONS INC

22430 SE 231 ST MAPLE VALLEY, WA 98038

Attn: MIKE ANDROSKO 206 379 7054

License No C80157J

**Engine Size** 

**Odometer In Odometer Out** 175351 175355

Cashiered

Stock No. **InServ Date** 

Home Cell

(425) 392-5722 Bus (206) 379-7054 Today Year Make 2017 **FORD** Vehicle ID No

Model F-150 Selling Dealer

Model No F1F **Extended Warranty**  Color RACE RED **Delivery Date** 

Type

CSR

Type

CSR

058

058

CF

CF

Email

mandrosko@jrhayes.com

Description

999 -

1FTMF1EP1HKD60387

20

Fleet # P117

Job

Job

5

4

Labor

SHU

**Term CHARGE** 

SHUTTLE - TRANSPORT CUSTOMER TO LOCATION OF THEIR CHOICE WITH IN LOCAL AREA

2.7L V6 ECOBOOST

Parts Total Labor Total

Request Sub-total

0.00 0.00

**Amount** 

0.00

0.00

Status

Approved

**Amount** 

9.95

9.95

48.91

Status

0.00 0.00

0.00

49.40

Approved

Technician

Request

**WB** 

Description CUSTOMER REQUESTS REPLACE WIPER BLADES - MULTI-FIT BLADES

WB Labor

CUSTOMER REQUESTS REPLACE WIPER BLADES - MULTI-FIT BLADES

**Part** WW 2248 A Technician

350 -

CUSTOMER REQUESTS REPLACE WIPER BLADES - MULTI-FIT BLADES Cause REPLACED WIPER BLADES. Correction

**BLADE ASY - WIPER** 

Description

Shp

Bin Type CRO P/S

Price **Amount** 19.48 38.96 38.96

Parts Total Labor Total Request Sub-total

Request Description 99PX

MULTIPOINT INSPECTION-CAR

Parts Total Labor Total Request Sub-total

Labor **Parts** 

Tax

69.87 5.96 Supplies 125.23 SUB-TOTAL 11.02

TOTAL INVOICE

136.25

TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Cinnatures		



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

**SERVICE DEPARTMENT HOURS:** 

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

058

## O2 6209 PUT 120

#### SO # 462592

Printed

Page

0.00

0.00

0.00

**Customer No** 145648 Attn: MIKE ANDROSKO 206 379 7054 JR HAYES CONSTRUCTION 22430 SE 231 ST MAPLE VALLEY, WA 98038

04/11/2022 1:27:13 PM

Home (425) 392-5722 Bus

(206) 379-7054 Today (425) 392-5722 Cell

Email mandrosko@jrhayes.com

SERVICE ORDER
<b>CUSTOMER COPY</b>

Dixie Thompson Promised Advisor 04/08/2022 6:00 PM Tag B431 Shop 04/08/2022 7:43 AM Location 081 S2 Opened 20 Cashiered PO# **Priority** 

License No Odometer In **Odometer Out** InServ Date Stock No C80157J 155027 155032 Year Make Model **Model No** Color 2017 **FORD** RACE RED F-150 F1E **Extended Warranty** Vehicle ID No Selling Dealer **Delivery Date** 1FTMF1EP1HKD60387 Fleet # P117 **Engine Size** 2.7L V6 ECOBOOST

Labor Total

Request Total

User

**Term CHARGE** 

Description **CSR Status** Request Job **ENGINE** CUSTOMER STATES THE ENGINE FAN DOESNT TURN OFF, CHECK AND ADVISE. Original 058 **Amount** Labor Description Type CUSTOMER STATES THE ENGINE FAN DOESNT TURN OFF, CHECK AND ADVISE. WF **ENGINE** Description Shp Bin Retail **Price Amount Part** Type HL3Z 19703 K **COMPRESSOR ASY** 

9W7Z 19B596 A 1 W 111 **CONDENSER ASY** W HL3Z 19712 C 1 HL3Z 19849 D VALVE ASY - EVAPORATOR EXPANSI 112 W DS7Z 19B596 A KIT - AIR CONDITIONING SYSTEM 1 111 W 6E5Z 19E889 E "O" RING W 111 6E5Z 19E889 D "O" RING 111 W YN 12 D OIL - COMPRESSOR - AIR CONDITI LB<sub>1</sub> W 1 **REFRIGERANT - R1234YF** 25 U201 W **YN 33** Technician 081 -Parts Total

VERIFIED THE CUSTOMER'S CONCERN OF COOLING FAN RUNS ON HIGH Cause

ALL THE TIME. PERFORMED A COMPLETE VISUAL INSPECTION BY REMOVING THE ENGINE COVER AND NOTHING ABNORMAL NOTED ACCESSED THE DIAGNOSTIC PORT AND PERFORMED A SCAN USING THE IDS TO FIND NO RELEVANT DIAGNOSTIC CODE(S). PERFORMED A A/C COMPRESSOR EXAMINATION AND DIAGNOSTIC. ATTACHED THE A/C GAUGES AND CHECKED THE REFRIGERANT PRESSURES TO FIND A HIGH SIDE PRESSURE OF 280 PSI A LOW SIDE PRESSURE OF 48 PSI AND AT AN AMBIENT TEMPERATURE OF 58 DEGREES WHICH IS OUT OF SPECIFICATIONS. EVACUATED AND RECHAGED THE SYSTEM WITH REFRIGERANT R-1234YF REMOVING .678 GRAMS OF REFRIGERANT, PULLED SYSTEM INTO A VACUUM GRAMS OF REFRIGERANT, DURING AIR CONDITIONING SERVICE PERFORMED A LEAK CHECK AND FOUND A LEAK PRESENT. PERFORMED AN AIR CONDITIONING SYSTEM LEAK

EXAMINATION BY ADDING FLUORESCENT DYE AND USING A BLACK LIGHT TO FIND THE SYSTEM IS LEAKING REFRIGERANT AT THE COMPRESSOR. FOUND THE A/C COMPRESSOR IS THE POINT OF CONCERN. FURTHER EXAMINATION FOUND THE A/C COMPRESSOR IS LEAKING AND IS NOISY

AND HAS AN IMPROPER PRESSURES.



#### TERMS CASH: UNLESS ARRANGEMENTS MADE, LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%. PRIVACY STATEMENT: Ask us if you would like information about our Privacy Policy, including our service providers and their data processing in the U.S., which may be accessible to U.S. law enforcement and

national security authorities. We provide this personal and transaction information to Ford Motor Company of Canada, Limited to enable Ford to administer your transaction, provide you with requested services, improve automotive related products and services by conducting customer surveys, and provide you with marketing material which may be of interest to you, as permitted by applicable laws. For the Ford Privacy Policy (www.ford.ca) including use of service providers and U.S. data storage or if you do not want to receive marketing or survey materials from Ford please call 1-800-565-FORD (3673).

Signature:

COPY



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM **MONDAY** 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM SATURDAY

#### SO # 462592

### SERVICE ORDER CUSTOMER COPY

**Printed** 

04/11/2022 1:27:13 PM

User

058

Page

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

JR HAYES CONSTRUCTION

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home

(425) 392-5722 Bus

Cell (206) 379-7054 Today (425) 392-5722

Email

mandrosko@jrhayes.com

**Term CHARGE** 

Advisor Dixie Thompson Promised Shop Opened

04/08/2022 6:00 PM 04/08/2022 7:43 AM

Tag Location

**B431** 081

PO#

Stock No

License No C80157J

Year

**Priority** 

145648

Odometer In 155027

155032

**Odometer Out** 

Cashiered

InServ Date

Color

Make 2017 **FORD** Vehicle ID No

Model F-150 Selling Dealer

**Model No** F1E **Extended Warranty** 

RACE RED **Delivery Date** 

1FTMF1EP1HKD60387

20

Engine Size 2.7L V6 ECOBOOST

Fleet # P117

Correction

ACCESSED, REMOVED AND REPLACED THE A/C COMPRESSOR WITH ALL OTHER RELATED SEALS GASKETS AND NON-REUSABLE HARDWARE AND REINSTALLED ALL COMPONENTS REMOVED FOR REPAIRS IN THE REVERSE ORDER OF REMOVAL AND ATTACHED AN A/C MACHINE PRINT OUT TO THE REPAIR ORDER. DUE TO CONSEQUENTIAL DAMAGE, ALSO ACCESSED, REMOVED AND REPLACED CONDENSER, FURTHER VISUAL **EXAMINATION FOUND CONSEQUENTIAL DAMAGE TO THE EXPANSION** VALVE, REMOVED AND REPLACED THE EXPANSION VALVE. EVACUATED, PULLED SYSTEM INTO A VACUUM, AND RECHARGED THE AIR CONDITIONING SYSTEM. PERFORMED QUALITY CONTROL, CLEANING, AND VISUAL INSPECTION. ROAD TESTED THE VEHICLE 5 MILES TO VERIFY REPAIRS DOCUMENTED THE VEHICLE IN MILEAGE AS 155027 MILES AND THE VEHICLE OUT MILEAGE AS 155032 MILES. THE SYSTEM IS NOW OPERATING AS DESIGNED.

Request	Description				Job	CSR	Status
WRKS	PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI- TO 6 QTS \$3.20 ADDL QTS	-POINT	INSPECTIC	N - UP	2	058	Approved
Labor	Description					Type	Amount
WRKS	PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI- \$3.20 ADDL QTS	-POINT	INSPECTIC	N - UP TO 6	QTS	CF	34.75
Part	Description	Shp	Bin	Type	Retail	Price	Amount
FL 2062 A	FILTER ASY - OIL	1	LB0	CRO	9.31	9.31	9.31
XO 5W30 BSF	OIL - ENGINE	6	BULK	CRO	3.20	3.20	19.20
ACPZ 1012 B	NUT - WHEEL	≥ 24	114	CRO15	3.18	2.70	64.80
FA 1883	ELEMENT ASY - AIR CLEANER	1	LB5	CRO15	20.99	17.84	17.84
Technician	081 -		Parts To	otal '			111.15
Correction	PERFORMED THE WORKS ALSO REPLACED THE AIR FILTER AND		Labor To	otal			34.75
	REPLACED ALL THE LUG NUTS DUE TO SWELLING		Reques	t Total			145.90
Request	Description				Job	CSR	Status
99PX	MULTIPOINT INSPECTION-CAR				3	058	Approved
		5	Parts To	otal			0.00
			Labor To	otal			0.00

TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

S.	ar	at	 •



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY : 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

#### SO # 462592

SERVICE ORDER

**Customer No** 

**Printed** 

04/11/2022 1:27:13 PM

145648

Attn: MIKE ANDROSKO 206 379 7054

JR HAYES CONSTRUCTION

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home Cell

(425) 392-5722 Bus

(206) 379-7054 Today (425) 392-5722

Email mandrosko@jrhayes.com

**Term CHARGE** 

**CUSTOMER COPY** 

User

058

Page

Advisor Shop **Priority** 

20

Dixie Thompson Promised Opened Cashiered 04/08/2022 6:00 PM 04/08/2022 7:43 AM

B431 Tag Location

081

PO#

License No C80157J

Odometer In 155027

2.7L V6 ECOBOOST

155032

**Odometer Out** 

**Model No** 

InServ Date

Stock No

Year Make 2017 **FORD** Vehicle ID No

**Engine Size** 

1FTMF1EP1HKD60387

Model F-150 **Selling Dealer** 

F1E **Extended Warranty** 

Color RACE RED **Delivery Date** 

Fleet # P117

0.00 Request Total Labor 34.75 **Parts** 111.15 Supplies 5.84 Discount 5.21 SUB-TOTAL 146.53 Tax 12.89 **TOTAL INVOICE** 159.42

#### TERMS CASH: UNLESS ARRANGEMENTS MADE, LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of. PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from recelpt and then returned to the manufacturer, reordering fees may apply. Returns-

Signature:				

		200



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### SERVICE DEPARTMENT HOURS:

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM SATURDAY

#### SO # 467294

#### SERVICE ORDER **CUSTOMER COPY**

Printed

09/09/2022 8:13:42 AM

145648

User

058

Page

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

J.R. HAYES AND SONS INC

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home Cell

(425) 392-5722 Bus

Email

(206) 379-7054 Today mandrosko@jrhayes.com

**Term CHARGE** 

Advisor Dixie Thompson Promised Shop S2

10

Opened Cashiered

66349

09/09/2022 6:00 PM 09/09/2022 7:01 AM

Tag Location

PO#

B664 9.9

InServ Date **Odometer Out** 

Stock No.

Х

66349

**Odometer in** 

Model SUPER DUTY F-350 SRW W3B

Model No

**Extended Warranty** 

Color

**Delivery Date** 

1FT8W3B68LED50570

Make

**FORD** 

6.2L 2-VALVE SOHC EFI NA V8 FLEX- Fleet # Engine Size

**Selling Dealer** 

Request

Description REPLACE MIRROR THAT WAS ORDERED WITH BEN, JR HAYES HIT THIS VEHICLE THIS IS **BODY** 

**Priority** 

Year

2020

License No

Vehicle ID No

Job 1

**Status** Original

NOT THEIR VEHICLE BUT THEY ARE PAYING FOR THE MIRROR

Labor

REPLACE MIRROR THAT WAS ORDERED WITH BEN, JR HAYES HIT THIS VEHICLE THIS IS NOT THEIR

058 Type

**CSR** 

Amount

0.00

175.00

175.00

**BODY** 

VEHICLE BUT THEY ARE PAYING FOR THE MIRROR

CF 175.00

Technician

Cause

VERIFIED THE CUSTOMER'S CONCERN. FOUND THE LEFT FRONT

POWER MIRROR ASSEMBLY IS THE POINT OF CONCERN. FURTHER

EXAMINATION FOUND THE LEFT FRONT POWER MIRROR ASSEMBLY

DAMAGED IN COLLISION.

Correction

REMOVED THE DOOR PANEL TO GAIN ACCESS TO THE LEFT FRONT POWER MIRROR ASSEMBLY. ACCESSED, REMOVED AND REPLACED THE

LEFT FRONT POWER MIRROR ASSEMBLY. THE SYSTEM IS NOW

OPERATING AS DESIGNED.

**CHECK VIN** 

02 6211 P117 050

Labor Parts

Parts Total

Labor Total

Request Sub-total

Supplies

Discount

SUB-TOTAL Tax

175.00 0.00 8.75 (26.25)

157.50 13.86

**TOTAL INVOICE** 171.36

TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Signature		



#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

PO BOX 217 • 526 ROOSEVELT AVE • ENUMCLAW, WA 98022

PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

## 01 6209 PIIT 120

145648

Advisor

C80157J

Year

2017

Shop

SO # 467212 Comeback

Status

Printed 09/08/2022 2:18:43 PM

SERVICE ORDER **CUSTOMER COPY** 

User

058

Location

Page

Amount

**Amount** 

39.45

9.31

21.60

30.91

39.45

70.36

**Customer No** Attn: MIKE ANDROSKO 206 379 7054

J.R. HAYES AND SONS INC

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home Cell Email

Part

(425) 392-5722 Bus (206) 379-7054 Today mandrosko@jrhayes.com

**Term CHARGE** 

Priority	50	Ca
License N	0	Odometer in

S2 50

**Odometer Out** 

Bin

Labor Total

Request Sub-total

Stock No **InServ Date** 

Retail

CODY

Tag

PO#

169080 169080

**Selling Dealer** 

Shp

Opened

Cashiered

Model F-150

Dixie Thompson Promised

**Model No** F1F **Extended Warranty** 

**Type** 

09/07/2022 6:00 PM

09/07/2022 7:03 AM

Color RACE RED **Delivery Date** 

Type

**Price** 

9.31

3.60

CF

B658

9.8

Х

**FORD** Vehicle ID No 1FTMF1EP1HKD60387

Make

**Engine Size** 2.7L V6 ECOBOOST Fleet # P117

CSR Job Status Description Request 058 Original **WRKS** PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP 1 TO 6 QTS \$3.20 ADDL QTS

Labor Description PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP TO 6 QTS **WRKS** 

\$3.20 ADDL QTS

LB0 CRO 9.31 FL 2062 A FILTER ASY - OIL 1 **BULK** CRO 3 60 OIL - ENGINE 6 XO 5W30 BSP Parts Total 0013 -Technician CHANGED ENGINE OIL AND OIL FILTER, PERFORMED A TIRE ROTATION Labor Total Correction AND INSPECTION, PERFORMED A TIRE TREAD DEPTH INSPECTION. Request Sub-total

PERFORMED A FOUR WHEEL BRAKE INSPECTION, PERFORMED A BATTERY TEST, PERFORMED A FILTER CHECK, CHECKED ALL THE BELTS AND HOSES, RESET THE MAINTENANCE INDICATOR. CHECKED AND RESET ALL OF THE TIRE PRESSURES, CHECKED AND TOPPED OFF

UNDER HOOD FLUID LEVELS.

Description

						2.5	
Request	Description				Job	CSR	Status
AXLE	CUSTOMER REQUEST REPLACE FRONT SHOCKS				2	058	Original
<b>Labor</b> AXLE	Description CUSTOMER REQUEST REPLACE FRONT SHOCKS					<b>Type</b> CF	<b>Amount</b> 687.13
Part	Description	Shp	Bin	Type	Retail	Price	Amount
NPN	SHOCK 73032	2		CRO15	264.39	264.39	528.78
W520214 S4	40 NUT	2	SPB6	CRO15	1.02	0.87	1.74
W520215 S4	40 NUT - HEX.	2	SPB6	CRO15	0.89	0.76	1.52
Technician	0013 -		Parts To	otal			532.04

Cause

Correction

Request

TO FIND BOTH FRONT STRUTS ARE THE POINT OF CONCERN. FURTHER **EXAMINATION FOUND BOTH FRONT STRUTS ARE WEAK.** 

ACCESSED, REMOVED AND REPLACED BOTH FRONT STRUTS AND ONE TIME USE FASTENERS. DRIVE TO VERIFY REPAIR. THE SYSTEM IS NOW

OPERATING AS DESIGNED.

Description

Job

CSR Status

687.13

1,219.17

TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Cianatura			



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### SERVICE DEPARTMENT HOURS:

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

SO # 467212

Comeback **Status** 

09/08/2022 2:18:43 PM Printed

SERVICE ORDER **CUSTOMER COPY** 

User

058

Page

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

J.R. HAYES AND SONS INC

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home Cell

(425) 392-5722 Bus (206) 379-7054 Today

Email

mandrosko@jrhayes.com

**Term CHARGE** 

Advisor

S2 50

Dixie Thompson Promised Opened Cashiered 09/07/2022 6:00 PM

Tag

3

Job

Retail

21.95

Job

5

B658

09/07/2022 7:03 AM

InServ Date

Location 9.8 PO# Х

License No C80157J

Vehicle ID No

Shop

Year

2017

**Priority** 

145648

Odometer In 169080

Model

F-150

Selling Dealer

Shp

**Odometer Out** 169080

Model No

Color

Stock No

F1F **Extended Warranty**  RACE RED **Delivery Date** 

**CSR** 

Type CF

Price

21.95

058

**FORD** 1FTMF1EP1HKD60387

Make

2.7L V6 ECOBOOST **Engine Size** 

Fleet # P117

99PX-TR

MULTIPOINT INSPECTION-TRUCK

Parts Total Labor Total 058 Approved 0.00

Request Sub-total

Type

CRO

0.00

0.00

**Status** 

11.66

21.95

21.95

11.66

33.61

Amount

Approved **Amount** 

Labor	Description
626	REPLACE E
Request	Description

626

**Part** 

FA 1883

Technician 0013 -

Cause

Correction

Request SUBLET

Labor SUBLET

Sublet

50636.1

Technician Correction

Description NGINE AIR FILTER

REPLACE ENGINE AIR FILTER Description **ELEMENT ASY - AIR CLEANER** 

EXAMINATION FOUND THE AIR FILTER ELEMENT(S) IS DIRTY AND REPLACEMENT IS RECOMMENDED BY MANUFACTURER TIME AND

MILEAGE. ACCESSED, REMOVED AND REPLACED THE AIR FILTER ELEMENT(S). CLEANED THE ENGINE AIR FILTER HOUSING. THE SYSTEM IS NOW

OPERATING AS DESIGNED.

Description REPLACE WINDSHEILD Description

REPLACE WINDSHEILD

999 -

Description 674/FOOTHILLS AUTOGLASS LLC/WINDSHEILD Labor Total

Bin

LB5

Parts Total

Parts Total

Labor Total

Request Sub-total

Request Sub-total

Status **CSR** 058 Type

Approved **Amount** 0.00 CF Amount

297.00

297.00

297.00

0.00

**CSR** Type **CSUB** 058

#### TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

FOOHILLS REPLACED WINDSHEILD

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Fignatures	

£ .... =



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

SO # 467212

Status

Comeback

09/08/2022 2:18:43 PM Printed

058

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

J.R. HAYES AND SONS INC

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home Cell

(425) 392-5722 Bus (206) 379-7054 Today

Email

mandrosko@jrhayes.com

**Term CHARGE** 

SERVICE ORDER **CUSTOMER COPY** 

User

Page

Advisor Dixie Thompson Promised

S2

Opened Cashiered 09/07/2022 6:00 PM 09/07/2022 7:03 AM

Tag Location PO#

B658

9.8 Х

License No C80157J

Shop

**Priority** 

145648

Odometer in 169080

Model

**Odometer Out** 169080

Model No

Stock No

Year Make 2017 **FORD** Vehicle ID No

F-150 **Selling Dealer** 

F1F **Extended Warranty** 

**InServ Date** 

Color RACE RED **Delivery Date** 

1FTMF1EP1HKD60387

2.7L V6 ECOBOOST Engine Size

Fleet # P117

FOOTHILLS COMING THURSDAY TO DO WINDSHEILD

738.24 Labor 584.90 Parts 66.16 Supplies 297.00 Sublet/Tow Discount (110.74)1.575.56 **SUB-TOTAL** 138.65

TOTAL INVOICE

1.714.21

TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability. Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-

Signature:		



#### **REMIT TO:**

PO Box 102935 Pasadena CA 91189-2935

	-	100	
			-
C		OT	_

Invoice Date	Cust No.	Order No	Page	Invoice No.
05/31/2022	101006	812 - 28762	1 / 1	
License:		Mileage: 0		
	CHK'D BY:	DELV'D BY:	_	

GCR 795436 MT VERNC812TTC **501 JACKS LANE MOUNT VERNON, WA 98273** Phone: (360) 428-8612

J R HAYES & SONS

22430 S E 231ST

Sold To:

Ship To:

JR HAYES & SONS 22430 S E 231ST

Ship Via

**MAPLE VALLEY, WA 98038-8272** 

MAPLE VALLEY, WA 98038-8272

		/6	60113		
Purchase Ord. No.	Sales	Main Phone	Other Phone		

Person

Terms: NET 1ST 157	ГΗ
Entered: BF	

	8156 (425) 392-5722 Alt: (425) 392-9451	Deliver				
Item No.	Description	Qty Ordered	Qty Shipped	F.E.T.	Price	Net Extension
PSSC01	PASS SERV SERVICE CALL	1.00	1.00		116.00	116.00
MILEAGEFEE	MILEAGE FEE	1	1		0.97	0.97
LTMI02	LT TRK SERV M&D/BALANCE PKG	4	4		45.00	180.00
LTMI10	LIGHT TRUCK TIRE DISPOSAL FEE	4	4		5.00	20.00
245723	FS LT265/70R17 DEST MT2 OWL 121Q E	4	4		299.99	1,199.96
MSMI01	SERVICE CONSUMABLES	1 1	1	Į.	20.00	20.00
WATIREFEE	NEW TIRE FEE	4	4		1.00	4.00

Customer authorizes company to perform the above written services to their vehicle.

SEE INFORMATION STATEMENT REGARDING CONSUMER CREDIT CONTRACT AND SECURITY

AGREEMENT www-wchua.gertires.com/securityagreement

Industry guidelines require that the torque level of the wheel nuts be rechecked between 50 to 100 miles of

operation and re-torqued as necessary. Failure to do so may result in a loss of this assembly.

PRINT NAME / AUTHORIZED SIGNATURE

NOTE:In order to save all FINANCE CHARGES, the customer must pay in full, the entire unpaid balance by the 10th of the following month. FINANCE CHARGES are computed on amounts 30 days or more past due at the PERIODIC RATE of 1.5% PER MONTH (MINIMUM CHARGE OF \$1.00) which is an ANNUAL PERCENTAGE RATE OF 18%. The above credit terms have been set out in accord with the Truth-in-Lending requirements of the Federal Government and are for the customer's benefit and protection

**Sub-Total Parts:** 

**Sub-Total Labor:** 296.00

Non-Taxable Amount:

4.00

**Taxable Amount:** 

1,536.93

Tax Total:

133.71 1,674.64

**Less Deposit:** 

0.00

**Less Payments:** 

0.00

**Balance Due:** 

1,674.64

1,244.93

DO NOT PAY. THIS IS A QUOTE.



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM TUES - FRIDAY ... 8:00 AM - 4:30 PM **SATURDAY** 

SO # 460886

Status WAITING

**Printed** 02/09/2022 8:38:29 AM

SERVICE ORDER **CUSTOMER COPY** 

CDL Page

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

JR HAYES CONSTRUCTION

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home

(425) 392-5722 Bus

Cell

Request

99PX-TR

Description

Email mandrosko@irhayes.com

(206) 379-7054 Today (425) 392-5722

**Term CHARGE** 

User Advisor Cary Lindsay **Promised** 02/09/2022 6:00 PM Tag Shop 02/09/2022 6:48 AM S2 Opened

License No Make

40

Odometer In

**Odometer Out** 

Location

PO #

C80157J Year

2017

**Priority** 

145648

149688

149689 Model

Cashiered

**Model No** 

Color

Stock No

FORD F-150 F1E Vehicle ID No Selling Dealer

**Extended Warranty** 

**InServ Date** 

RACE RED **Delivery Date** 

B232

1FTMF1EP1HKD60387

**Engine Size** 2.7L V6 ECOBOOST Fleet # P117

Request Description CSR Joh **Status WRKS** PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP 437 Original TO 6 QTS \$3.20 ADDL QTS Labor Description Amount Type **WRKS** PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP TO 6 QTS CF 34.75 \$3.20 ADDL QTS 99PX PERFORM MULTI-POINT INSPECTION - FORD XPRESS CF 0.00 **GTIRE** GREEN TIRES 7/32 OR GREATER CF 0.00 **GBK GREEN BRAKES GOOD AT THIS TIME** CF 0.00 **GBATT GREEN BATTERY STATUS GOOD** CF 0.00 **Part** Description Shp Bin Type **Price Amount** FL 2062 A FILTER ASY - OIL L<sub>B</sub>0 CRO 9.31 9.31 XO 5W30 BSP OIL - ENGINE 6 **BULK** CRO 3.20 19.20 Technician 0013 -Parts Total 28.51 Correction PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT Labor Total 34.75 INSPECTION. Request Total 63.26



Request Total 0.00 Labor 34.75 Parts 28.51 Supplies 2.53 SUB-TOTAL 65.79

Job

Parts Total

Labor Total

2

**CSR** 

437

**Status** 

0.00

0.00

5.79

Approved

TOTAL INVOICE 71.58

#### TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

MULTIPOINT INSPECTION-TRUCK

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from recelpt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Signature:			
Signature:			

wa00



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### SERVICE DEPARTMENT HOURS:

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

#### SO # 449921

JR HAYES CONSTRUCTION

SERVICE ORDER

Printed	

01/15/2021 1:18:12 PM

145648

**CUSTOMER COPY** 

User

VINCE

Page

**Customer No** Attn: MIKE ANDROSKO 206 379 7054

Advisor Vince Swanson Shop S2 Priority 20

Promised Opened Cashiered

**Odometer Out** 

114689

01/14/2021 5:00 PM 01/14/2021 5:52 AM Tag Location PO#

B649 1.15 P117

22430 SE 231 ST MAPLE VALLEY, WA 98038

(425) 392-5722 Bus

Home Cell Email

(206) 379-7054 Today (425) 392-5722 mandrosko@jrhayes.com

License No C80157J Year Make 2017 **FORD** 

**Vehicle ID No** 

Model

114686

**Odometer In** 

F-150 **Selling Dealer** 

F1E **Extended Warranty**  Color RACE RED

Stock No

1FTMF1EP1HKD60387

**Engine Size** 2.7L V6 ECOBOOST Fleet # P117

InServ Date

**Model No** 

**Delivery Date** 

YF 37489

**Term CHARGE** "O" RING

**COMPRESSOR ASY** 

REFRIGERANT - R1234YF

112

U200

6.45 6.45 492.00 492.00

9.58

CSR

Technician

Correction

YCC 422

**YN 33** 

Cause

350 -

REPLACE A/C OMPRESSOR AND RELATED PARTS PER LAST VISIT,

RECOVERED FREEON, REPLACED AC COMPRESSOR, TXV VALVE. REMOVED CONDENSER FOR ACCES TO DESICANT BAG, REPLACED BAG.

REINSTALLED CONDENSER. EVAC AND RECHARGED AC SYSTEM.

TESTED. AC WORKS GOOD.

Description Request 99PX

MULTIPOINT INSPECTION-CAR

Parts Total

1

1

8

Labor Total 1,110.00

CRO

CRO

CRO

Request Total

1,911.33

76.64

801.33

Status

792 Approved Parts Total 0.00 Labor Total 0.00 Request Total 0.00

Job

WRKS,A/C COMP

1,142.19 Labor 829.84 Parts Supplies 53.23 284.31 Discount 1,740.95 SUB-TOTAL 151.46 Tax

TOTAL INVOICE

1.892.41

#### TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

COPY



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### SERVICE DEPARTMENT HOURS:

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

VINCE

#### SO # 449921

Printed

Type

CF

Amount

1,110.00

Page

145648 **Customer No** Attn: MIKE ANDROSKO 206 379 7054 JR HAYES CONSTRUCTION 22430 SE 231 ST MAPLE VALLEY, WA 98038

01/15/2021 1:18:12 PM

Home (425) 392-5722 Bus

(206) 379-7054 Today (425) 392-5722 Cell

Email mandrosko@jrhayes.com

**Term CHARGE** 

SER	VICE	OR	DEF	2
CUST	ГОМЕ	RC	OP	Y

Advisor Vince Swanson 01/14/2021 5:00 PM Tag B649 **Promised** 01/14/2021 5:52 AM Shop Opened Location 1.15 **S2** PO# P117 20 Cashiered **Priority** 

User

**InServ Date** Stock No License No **Odometer Out** Odometer In C80157J 114686 114689 Color Year Model No Make Model RACE RED 2017 F-150 F1F FORD Selling Dealer Vehicle ID No **Extended Warranty Delivery Date** 1FTMF1EP1HKD60387 **Engine Size** 2.7L V6 ECOBOOST Fleet # P117

**CSR** Request Description Job **Status** PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP 792 Original **WRKS** TO 6 QTS \$3.20 ADDL QTS

**Amount** Type Labor Description CF PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP TO 6 QTS 32.19 **WRKS** \$3.20 ADDL QTS CF 0.00 **GBATT GREEN BATTERY STATUS GOOD** CF 0.00 **GTIRE GREEN TIRES 7/32 OR GREATER GBK** GREEN BRAKES GOOD AT THIS TIME CF 0.00

Bin Type **Price Amount Part** Description Req 9.31 L<sub>B</sub>0 CRO 9.31 FL 2062 A FILTER ASY - OIL 3.20 19.20 XO 5W30 BSP OIL - ENGINE 6 **BULK** CRO 350 -Parts Total 28.51 Technician

PERFORM THE WORKS-OIL CHANGE. TIRE ROTATION AND MULTI-POINT Labor Total 32.19 Cause INSPECTION - UP TO 6 QTS \$3.20 ADDL QTS 60.70 Request Total

LOF, MPI, ROTATED TIRES, SET PSI. Correction

Job **CSR** Status Request Description 2 792 Original REPLACE A/C OMPRESSOR AND RELATED PARTS PER LAST VISIT, **HEATER** 

Labor Description **HEATER** REPLACE A/C OMPRESSOR AND RELATED PARTS PER LAST VISIT.

Req Bin **Price Amount** Type Part Description CRO 6.87 6.87 112 YF 3534 **CRO** 14.67 44.01 3 112 YF 37200 KIT - AIR CONDITIONING SYSTEM CRO 6.82 6.82 YF 37488 "O" RING 1 112 48.76 48.76 YG 815 VALVE ASY - EVAPORATOR EXPANSI 1 112 CRO YF 37512 ACCUMULATOR ASY - AIR CONDITIO U200 CRO 119.78 119.78

#### TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Signature:			



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

SO # 445203

Status WAITING

**Printed** 08/14/2020 10:11:12 AM

SERVICE ORDER CUSTOMER COPY

Vince Swanson

S2

40

User

08/14/2020 5:00 PM

08/04/2020 8:04 AM

VINCE

Tag

PO#

CRO

Job

5

Location

Page

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

JR HAYES CONSTRUCTION

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home

(425) 392-5722 Bus

Cell

(206) 379-7054 Today (425) 392-5722

Email

mandrosko@jrhayes.com

License No C80157J

Vehicle ID No

Advisor

Shop

Year

2017

**Priority** 

100389 100389 Model

Odometer In

F-150 Selling Dealer

**Promised** 

Cashiered

Opened

**Odometer Out** 

F1E **Extended Warranty** 

InServ Date

**Model No** 

RACE RED **Delivery Date** 

Stock No

Color

B749

8/14

P117

**Term CHARGE** 

ANTI-FREEZE

**Engine Size** 

Make

**FORD** 

1FTMF1EP1HKD60387

2.7L V6 ECOBOOST

Fleet # P117

B/RM

SPB17

18.31 36.62

VC 13DL G 390018 S

PIN 0.25 X 1.06 PUSH NYLON

Parts Total

CRO 4.13

12.39

Technician Cause

INSPECT AND FOUND A MESSAGE FROM FORD ON REPLACING THE LEFT Labor Total

HAND TURBO OIL TUBE P+A PARTS PER MESSAGE WAS UNABLE TO

145648

VERIFY SMOKE ON START UP, ORDERED APRTS

**Request Total** 

2

3

1,110.58 1.354.94

244.36

Status

792 Approved

1.527.07

Correction

INSTALLED THE UPDATED LEFT HAND TURBO OIL FEED TUBE TOPPED OFF THE COOLANT AND PERFORMED TEST DRIVE STILL UNABLE TO

VERIFY THE CONCERN

Request 99PX

Description

081 -

MULTIPOINT INSPECTION-CAR

Parts Total Labor Total

Request Total

TOTAL INVOICE

0.00 0.00 0.00

**CSR** 

TTF, WRKS, BLUE SMOKE, 18S27

OIL Cheje Trans où chyl: Recall

1,249.92 Labor 402.85 Parts Supplies 0.00 Discount 247.92 SUB-TOTAL 1.404.85 Tax2 0.00 122.22 Tax

TERMS CASH: UNLESS ARRANGEMENTS MADE. LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

PRIVACY STATEMENT: Ask us if you would like information about our Privacy Policy, including our service providers and their data processing in the U.S., which may be accessible to U.S. law enforcement and national security authorities. We provide this personal and transaction information to Ford Motor Company of Canada, Limited to enable Ford to administer your transaction, provide you with requested services, improve automotive related products and services by conducting customer surveys, and phytope you with marketing material which may be of interest to you, as permitted by applicable laws. For the Ford Privacy use of service providers and 9.5. data storage or if you do not want to receive mor eting or survey materials from Ford please call 1-800-565-FORD (3673). Policy (www.ford.ca) including

Signature:



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM **TUES - FRIDAY** 8:00 AM - 4:30 PM **SATURDAY** 

SO # 445203

WAITING Status

Printed 08/14/2020 10:11:11 AM

SERVICE ORDER **CUSTOMER COPY** 

Vince Swanson

User

08/14/2020 5:00 PM

08/04/2020 8:04 AM

VINCE

Location

Tag

PO#

Job

Page

**Customer No** 

145648

Attn: MIKE ANDROSKO 206 379 7054 JR HAYES CONSTRUCTION

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home

(425) 392-5722 Bus

Cell

(206) 379-7054 Today (425) 392-5722

Email mandrosko@jrhayes.com

**Term CHARGE** 

License No

S2

40

Odometer In 100389

**Odometer Out** 100389

InServ Date

Stock No Color

C80157J Year

Vehicle ID No

2017

Advisor

Shop

**Priority** 

Make Model **FORD** 

F-150 Selling Dealer

**Promised** Opened

Cashiered

**Model No** F1E **Extended Warranty** 

RACE RED **Delivery Date** 

**CSR** 

792

Type

CF

**R749** 

8/14

P117

1FTMF1EP1HKD60387

**Engine Size** 2.7L V6 ECOBOOST Fleet # P117

Status

Original

Amount

107.15

83.40

34.69

Request 611M

Description TRANSMISSION SERVICE CAR, SUV AND F150 TRUCK - PERFORM TRANSMISSION FLUID SERVICE USING UP TO 15 QUARTS OF MERCON 5 TRANSMISSION FLUID, VERIFY PROPER

FLUID LEVEL AND ROAD TEST TO VERIFY PROPER TRANSMISSION OPERATION.

(ADDITIONAL COST FOR SYNTHETIC OIL OR ADDITIONAL OIL.)(WITH JUSTICE BROTHERS

ADDITIVE)

Labor 611M

**Part** 

Description

OR ADDITIONAL OIL.)(WITH JUSTICE BROTHERS ADDITIVE)

Description OIL - AUTOMATIC TRANSMISSION

XT 10 QLVC ATF SUPPLEMENT 59P

Description

Technician Correction

081 -

SERVICED THE TRANS WITH JB

TRANSMISSION SERVICE CAR, SUV AND F150 TRUCK - PERFORM TRANSMISSION FLUID SERVICE USING UP TO 15 QUARTS OF MERCON 5 TRANSMISSION FLUID, VERIFY PROPER FLUID LEVEL AND ROAD TEST TO VERIFY PROPER TRANSMISSION OPERATION. (ADDITIONAL COST FOR SYNTHETIC OIL

> Rea 15 1

Parts Total

B/RM LB2

Bin

Type **Price Amount** CRO 5.56 CRO 34.69

> 118.09 107.15

Description Request FIELD SERVICE ACTION - 18S27 CARPET SHIELDING AND INSULATION REWORK

Labor Total Request Total

225.24 **CSR Status** 

792

Type

WF

2.00

**FSA** Labor

**FSA** 

Part

NPN

FIELD SERVICE ACTION - 18S27 CARPET SHIELDING AND INSULATION REWORK

Description **TAPE** 

INSTALLED CARPET SHIELD PER RECALL

Bin

Price Type

Job

CRO

2

**Amount** 2.00

Original

Amount

Technician Correction

Parts Total Labor Total Request Total

Req

2.00 0.00 2.00

TERMS CASH: UNLESS ARRANGEMENTS MADE, LABOR RATE BASED ON PER FLAT RATE HOUR.

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retall service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Signature:			
Signature.			

	¥			900
		(6)		



PHN: 360-825-7731 • FAX: 360-825-1043

TOLL FREE: 1-800-539-7595 • WWW.FUGATEFORD.COM

#### **SERVICE DEPARTMENT HOURS:**

7:00 AM - 6:00 PM MONDAY 7:00 AM - 7:00 PM TUES - FRIDAY 8:00 AM - 4:30 PM SATURDAY

#### SO # 445203

WAITING **Status** 

08/14/2020 10:11:12 AM Printed

#### SERVICE ORDER CUSTOMER COPY

Vince Swanson

S2

40

User

08/14/2020 5:00 PM 08/04/2020 8:04 AM VINCE

Location

Tag

PO #

Page

**Customer No** 

Attn: MIKE ANDROSKO 206 379 7054

JR HAYES CONSTRUCTION

22430 SE 231 ST

MAPLE VALLEY, WA 98038

Home

(425) 392-5722 Bus

Cell

**Part** 

FU7Z 9T516 A

FT4Z 6N652 D

W716383 S437

W714870 S430

(206) 379-7054 Today (425) 392-5722

**Term CHARGE** 

GREEN BRAKES GOOD AT THIS TIME

Email

mandrosko@jrhayes.com

License No	L	icense	No
------------	---	--------	----

Odometer In

**Odometer Out** 

InServ Date

Stock No

B749

8/14

P117

C80157.J Year Make

2017

Advisor

Shop

Priority

100389 Model F-150

Model No F1E

Color

145648

**FORD** Vehicle ID No 1FTMF1EP1HKD60387

Selling Dealer

**Promised** 

Cashiered

100389

Opened

**Extended Warranty** 

RACE RED **Delivery Date** 

CF

0.00

**Engine Size** 2.7L V6 ECOBOOST Fleet # P117

Job CSR **Status** Request PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP 792 Original 3 **WRKS** TO 6 QTS \$3.20 ADDL QTS

Amount Labor Description Type CF PERFORM THE WORKS-OIL CHANGE, TIRE ROTATION AND MULTI-POINT INSPECTION - UP TO 6 QTS 32.19 **WRKS** \$3.20 ADDL QTS CF 0.00 **GREEN BATTERY STATUS GOOD GBATT** 0.00 CF **GTIRE GREEN TIRES 7/32 OR GREATER** 

**GBK Price** Req Bin Type **Amount** Part Description **BULK** MOTORCRAFT 5W20 OIL 6 CRO 3.20 19.20 XO 5W20 BSP

CRO 19.20 19.20 KIT - ELEMENT & GASKET - OIL F 1 FL 2062 A Parts Total 38.40 Technician 081 -

32.19 PERFORMED THE WORKS Labor Total Correction 70.59 Request Total Job **CSR** Status Request Description

792 Original ON START UP BLUE EXHAUST COMES OUT OF THE EXHAUST, COLD OR WARM ESP ON MAINT WARM RESTART, CHECK AND ADVISE

Type **Amount** Description Labor ON START UP BLUE EXHAUST COMES OUT OF THE EXHAUST, COLD OR WARM ESP ON WARM CF 1.110.58 MAINT

RESTART, CHECK AND ADVISE

Price Bin Amount Type Req CRO 182.76 182.76 5.95 120 CRO 5.95 1 SPB13 CRO 1.95 1.95 1 4.69 SPB11 CRO 4 69

TERMS CASH: UNLESS ARRANGEMENTS MADE, LABOR RATE BASED ON PER FLAT RATE HOUR.

Description

**TUBE ASY** 

GASKET

STUD

NUT

QUALITY CARE FOR QUALITY CARS.

We have made a commitment to quality customer service. We pledge to do our best to ensure your satisfaction with your vehicle from pre-delivery through warranty and retail service. If you should experience difficulty with your vehicle, please let us know. We'll correct it to the best of our ability.

Behind this pledge is the dedication and commitment of the professional team of people working in this dealership. Whether you're dealing with our sales, parts or service department, you'll be taken care of.

PARTS RETURN POLICY: No return on all electrical parts. Special order parts must be pre-paid and will be held for 45 days from receipt and then returned to the manufacturer, reordering fees may apply. Returns-Cores- Must have original invoice and be in factory package. Restock fee is 25%.

Cianaturas				

Customer

Name

Comments:

JR HAYES CONSTRUCTION

#### 22430 SE 231 ST Address MAPLE VALLEY, WA City Zip Code 98038 PhoneNumber (206) 379-7054(c) mandrosko@jrhayes.com Email <u>Inspection</u> Service Order 449921 Advisor Vince Swanson Jim Ellison Tech LIGHTS OPERATION OF EXTERIOR LIGHT BULBS, ok 🔽 BRAKE LIGHTS AND TURN SIGNALS : No Comments: WINDSHIELD WIPER OPERATION WINDSHIELD WIPER AND WASHER OK 🔽 SQUIRTER OPERATION Comments: OK 🗾 WINDSHIELD WIPER BLADES Comments: **HORN** HORN OPERATION OK V Comments: WARNING LIGHTS OK 🔽 WARNING LIGHTS ON THE DASH Comments: **BATTERY** BATTERY COLD CRANKING AMPS Comments: BATTERY CABLES AND TERMINAL OK 🗸 CORROSION

Verifiere			
VIN	1FTMF1EP1HKD60387		
Year	2017		
Make	FORD		
Model	F-150		
Engine	2.7L V6 ECOBOOST		
Fuel			
Stock Number			
License/Stock	C80157J		
Date In	01/15/2021 12:37:13 PM		
Completed Date			
Odom	114686		
HNDED H	OOD INSPECT	TION	
	L AND CONDITION		<b>V</b>
Comments:	L AND CONDITION	OK	
ENGINE COOLANT	LEVEL AND	OK	/
CONDITION			
Comments:			
ENGINE COOLING	,	OK	
RADIATOR VISUAL	INSPECTION		
Comments:	LUD LEVEL AND	OK	<b>V</b>
TRANSMISSION FI		UK	
DIPSITCK)	OII ( LD WITH I )		
Comments:			
POWER STEERING	G FLUID LEVEL AND	N/A	
CONDITION			
Comments:			
BRAKE FLUID LEV	EL AND CONDITION	OK	<b>✓</b>
Comments:			
ENGINE AIR FILTE	R CONDITION	OK	الله أ
Comments:			
SERPENTINE BEL	T CONDITION	OK	<b>✓</b>
Comments:			
TIRES			
ALIGNMENT CHEC	K OR WHEEL	ОК	<b>V</b>
BALANCE NEEDEL	)		
Comments:			
	TREAD DEPTH / WEAR	7/32 OR	<b>✓</b>
PATTERN			
Comments: 10/32	E TOEAD DEDTILL	7/00 00	
WEAR PATTERN	E TREAD DEPTH /	7/32 OR	V
Comments:			
	READ DEPTH / WEAR	7/32 OR	1
PATTERN		7,02 311	
Comments: 10/32			
RIGHT REAR TIRE	TREAD DEPTH / WEAR	7/32 OR	/
PATTERN			
Comments:			
TIRE PRESSURE S	SET TO FACTORY	SET TO SPECS	
SPECS			
Comments:			

Vehicle

ADDITIONAL COMMENTS Comments:  UNDER VEHICLE INSPECTION SHOCKS / STRUTS Comments: STEERING LINKAGE COMPONENTS Comments: SUSPENSION COMPONENTS AND BALL JOINTS Comments: EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION Comments: DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS Comments:	OK OK		
UNDER VEHICLE INSPECTION SHOCKS / STRUTS Comments: STEERING LINKAGE COMPONENTS Comments: SUSPENSION COMPONENTS AND BALL JOINTS Comments: EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION Comments: DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK OK OK	\ \ \ \	
SHOCKS / STRUTS Comments: STEERING LINKAGE COMPONENTS Comments: SUSPENSION COMPONENTS AND BALL JOINTS Comments: EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION Comments: DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK OK OK	\ \ \ \	
Comments: STEERING LINKAGE COMPONENTS Comments: SUSPENSION COMPONENTS AND BALL JOINTS Comments: EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION Comments: DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK OK	\ \ \ \	
STEERING LINKAGE COMPONENTS Comments: SUSPENSION COMPONENTS AND BALL JOINTS Comments: EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION Comments: DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK OK	\ \ \	
Comments:  SUSPENSION COMPONENTS AND BALL JOINTS Comments:  EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION Comments:  DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments:  ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK OK	\ \ \	
SUSPENSION COMPONENTS AND BALL JOINTS Comments:  EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION Comments:  DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments:  ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK	<b>V</b>	
JOINTS Comments:  EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION  Comments:  DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION  Comments:  ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK	<b>V</b>	
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION  Comments:  DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION  Comments:  ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	ОК	V	
VISUAL INSPECTION  Comments:  DRIVE SHAFT UNIVERSAL JOINTS AND  CONSTANT VELOCITY (CV) BOOTS  VISUAL INSPECTION  Comments:  ENGINE OIL, COOLANT LEAKS, OR A/C  LEAKS	ОК	V	
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS			
CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS			
ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK		
LEAKS	OK		
Comments:		/	
TRANSMISSION / AWD FLUID LEAKS	OK	1	
Comments:			
DRIVE AXLE LEAKS	OK	1	
Comments:		Total Control	
POWER STEERING FLUID LEAKS	OK		
Comments:			
OIL CHANGE REMINDERS			
RESET OIL CHANGE REMINDER	YES	1	
NEW LUBE STICKER FOR WINDSHIELD	YES	~	
RETRAIN TPMS AFTER TIRE ROTATE - IF REQUIRED	YES	1	
BRAKES		T	
BRAKES NOT CHECKED ON THIS VISIT BRAKES	NOT	_	V
Comments:	.,01		14
	VI OR	1	
Comments: 6MM			
	M OR	1	
Comments:			
	M OR	V	
Comments: 5MM			
	II OR	1	
Comments:		-	

Fugate Ford P.O. BOX 217

ENUMCLAW, WA, 98022

to grant they be to





#### Customer

Name

JR HAYES CONSTRUCTION

Address

22430 SE 231 ST

City

MAPLE VALLEY, WA

Zip Code

98038

PhoneNumber

(206) 379-7054(c)

Email

mandrosko@jrhayes.com

# Inspection

Service Order

445203

Advisor

Vince Swanson

Tech

**GARY MCREYNOLDS** 

#### LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS, BRAKE LIGHTS AND TURN SIGNALS

: No

Comments:

# WINDSHIELD WIPER OPERATION

WINDSHIELD WIPER AND WASHER

SQUIRTER OPERATION Comments:

WINDSHIELD WIPER BLADES

Comments:

# HORN

HORN OPERATION

Comments:

WARNING LIGHTS

WARNING LIGHTS ON THE DASH

Comments:

BATTERY

BATTERY COLD CRANKING AMPS

Comments:

BATTERY CABLES AND TERMINAL

CORROSION

Comments:

#### Vehicle

VIN

1FTMF1EP1HKD60387

Year

2017

Make

**FORD** 

Model

F-150

Engine

2.7L V6 ECOBOOST

Fuel

Odom

ok 🔽 📕

OK 🔽

OK 🗸

OK V

OK 🔽

OK V

OK 🔽

Stock Number

License/Stock

C80157J 08/04/2020

Date In Completed Date

100389

# UNDER HOOD INSPECTION

ENGINE OIL LEVEL AND CONDITION	OK 🗹 📙
Comments:	
ENGINE COOLANT LEVEL AND	OK V

Comments:

ENGINE COOLING SYSTEM HOSES. RADIATOR VISUAL INSPECTION

Comments:

TRANSMISSION FLUID LEVEL AND CONDITION (IF EQUIPPED WITH A DIPSITCK)

Comments:

POWER STEERING FLUID LEVEL AND CONDITION

Comments:

BRAKE FLUID LEVEL AND CONDITION

**ENGINE AIR FILTER CONDITION** 

SERPENTINE BELT CONDITION Comments:

# TIRES

ALIGNMENT CHECK OR WHEEL **BALANCE NEEDED** 

LEFT FRONT TIRE TREAD DEPTH / WEAR **PATTERN** 

Comments: 12/32

RIGHT FRONT TIRE TREAD DEPTH /

WEAR PATTERN

Comments:

LEFT REAR TIRE TREAD DEPTH / WEAR **PATTERN** 

Comments: 12/32

RIGHT REAR TIRE TREAD DEPTH / WEAR **PATTERN** 

Comments:

Comments

TIRE PRESSURE SET TO FACTORY **SPECS** 

SET TO SPECS 🗸



OK V

OK 🗸

OK 🗸

OK V

OK V

OK 🔽

OK V

7/32 OR 🗸

7/32 OR 🗸 📉

7/32 OR 🔽 🔚

7/32 OR 🗸 📗

ANY ADDITIONAL COMME	NTS		
ADDITIONAL COMMENTS	OK	1	
Comments:			
UNDER VEHICLE INSPECT	ION		
SHOCKS / STRUTS	ОК	1	
Comments:			
STEERING LINKAGE COMPONENTS	OK	1	
Comments:			
SUSPENSION COMPONENTS AND BALL JOINTS	OK	1	
Comments:			
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	ОҚ	~	
Comments:			
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS	OK	1	
VISUAL INSPECTION			
Comments:			
ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK	1	
Comments:			
TRANSMISSION / AWD FLUID LEAKS	OK	<b>V</b>	
Comments:			Person
DRIVE AXLE LEAKS	OK		
Comments:	014	7	
POWER STEERING FLUID LEAKS	OK	V.	
Comments:			
OIL CHANGE REMINDERS			
RESET OIL CHANGE REMINDER	YES	1	
NEW LUBE STICKER FOR WINDSHIELD	YES	/	
RETRAIN TPMS AFTER TIRE ROTATE - IF : REQUIRED	YES	/	
BRAKES			
BRAKES NOT CHECKED ON THIS VISIT BR	AKES NOT	11	1
Comments:			
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	1	
Comments: 8MM			
RIGHT FRONT BRAKE PAD THICKNESS	6MM OR	1	
Comments: 8MM	M.		
LEFT REAR BRAKE PAD THICKNESS	6MM OR	1	
Comments: 6MM			
RIGHT REAR BRAKE PAD THICKNESS	6MM OR	1	
Comments: 6MM	5		

h jag

ALIGIR

68363(REPRINT)

LICENSE	YEAR			MODE		ENGINE	MILEAGE	DATE	TIME
WA-C80157J	2016	Ford Truc	ks F15	0 Pickup	<b>E</b> -p 6-c∶	2.7l (164) Turbo	31937	6/11/2018	02:27 PM
			VANCE SCH				SERVICES	COMPLETED	
RECOMME	NDED SE	RVICE	DATE 0		IILEAGE DUE	Full Service 1.0 - M9015	Oil Filters		40.95
Cooling System Engine Oil*			72 months 6 months	eve	ery 100000 ery 5000	Premium -C	Dil Filters		8.00
Front Differential			See Recs.	\$e	e Recs.	5.0 - VASYI Premium -C	NTHOEM Va Synth M	anufacture Specific	24.00
Rear Differential Transfer Case			See Recs.		e Recs. ery 60000	Extra 1.00	-VASYNTHOEM @ 7	.95	7.95
						Environment	Fee (T)		2.65
				V 1		1			
			1 ×	0 -1					
				- 1					
						_			
OUEOU	(LIOT ITE		K LIST	07.7	10	1			
CHECK	KLIST ITE	VI		STATU	JS				
							00	TO TO	
							$(( \ (( \ )$	PY	
								/ U U	
						SUBTOTAL			00.55
ANAGER:T		UPPER T	ECH: Marlin		OPER.3	TAX (PST)			83.55 7.19
COURTESYSamue	ı	LOWERT	ECH: Marlin		T/V: 4	100			7.13
SERVICE REMA		LOWER	EON: WATHII		1/V. →				
PLAVICE REMA	uuvo:					TOTAL			90.74
						AMOUNT	(Fleet Charge,	6000)	90.74
						TENDERED			.00
	1 48					CHANGE	***NEXT SCHE	DULED VISIT***	
						13.00	TEXT SOILE	DOLLD VIGIT	
	871.11	Ve							
Ve guarantee all our ne first opportunity to	parts and we	orkmanship.	If you do have a	a problem,	we must be given				
ervice packages incl				,554111E 1ES	pondiomity. All out				
certify that all work ha	s been perfori	med satisfact				<u>X</u>			
			MA	NAGER'S SI	GNATUHE		CUSTOMER	SIGNATURE	

67146(REPRINT)



LICENSE	YEAR	MAK		MODEL			ENGINE		MILEAGE	DATE	TIME
WA-C80157J	2016	Ford Trucks	s F15	0 Pickup	E-p	6-c 2.	.7I (164) Turl	00	25827	4/2/2018	08:56 AM
	(51110) 5	MAINITER	ANIOE OC:	EDITE					050,4050	COMPLETED	
			ANCE SCH		W 5405	D1 15	Full Sen	vice	SEHVICES	COMPLETED	40.95
RECOMMEN Cooling System Engine Oil* Front Differential Rear Differential Transfer Case	IDED SE		DATE I 72 months 6 months See Recs. See Recs.	eve eve See See	IILEAGE by 100000 by 5000 e Recs. e Recs. bry 60000		1.0 - M Premiu 5.0 - V Premiu Extra	9015 (m -Oil ASYNT m -Oil 1.00 -	HOEM Va Synth N VASYNTHOEM @ 33 - Air Filter	· ·	8.00
- 1											
		CHECK	LIST				]				
CHECK	LIST ITE	И		STATU	JS		1				
									CO		
MANAGER: <sup>T</sup> COURTESY <sup>Samue</sup> SERVICE REMA			ECH: Marlin		OPER: <sup>1</sup> T/V: <sup>3</sup>		SUBTOTAL TOTAL	<b>AL</b> (PST)			105.50 7.19 112.69
									(Fleet Charge	e. 6000)	112.69
							AMOUNT TENDERI CHANGE	ΞĎ			00
									***NEXT SCH	EDULED VISIT	**
We guarantee all out the first opportunity to service packages inc I certify that all work ha	to correct the clude both pa	e problem in a arts and labor.	order for us to								
)			N	IANAGER'S S	SIGNATURE		1		CUSTOM	ER SIGNATURE	



LICENSE	YEAR	MAKE	MOI	DEL	ENGINE	MILEAGE	DATE	TIME
WA-C80157J	2016	Ford Trucks	F150 Picki		2.7I (164) Turbo	68499	9/5/2019	08:49 AM
	 VEHICLE	MAINTENANC	E SCHEDUI			SERVICES	COMPLETED	2 10 10 10 10 12
RECOMME			DATE DUE	MILEAGE DU	Full Service			45.95
Cooling System		72 n	nonths	very 100000	1.0 - M9015 Premium -O			8.00
Engine Oil*				very 5000	5.0 - GTX53			0.00
Front Differential Rear Differential				See Recs. See Recs.	Premium -O			2.55
Transfer Case*				every 60000	Environment	-GTX530 @ 4.95 Fee (T)		4.95 2.65
				14.				
		CHECK LIS						
CHECK	LIST ITE			TUS				
OTIZOT	(2107172					CO		
						Col	900	
						U	11	
							4	
						22%		
					1			
						F.		
								*
3								
MANAGER: T		UPPER TECH:	Marlin	OPER: <sup>1</sup>	SUBTOTAL			64.10 5.52
MANAGER: ' COURTESY <sup>Samue</sup>	el	UPPER TECH:		OPER:	TAX (PST)			5.52
SERVICE REMA		LOWER TECH:		1/V.	TOTAL			69.62
					AMOUNT	(Fleet Charge	e, 6000)	69.62
					TENDERED CHANGE			.00
						***NEXT SCH	EDULED VISIT***	
We guarantee all ou	r parts and w	orkmanship. If you	do have a proble	ern, we must be give	en			
the first opportunity the first opportunity the service packages income the service packages in the service package in th	o correct the	problem in order					DOTAL CALL	
certify that all work ha	15 been peno	inied satisfactority		S SIGNATURE	_   X		R SIGNATURE	

AK 5/23/19 74702(REPRINT)

J.r. Hayes And Sons P117 22430 Se 231st Maple Valley, WA 98038 425-392-5722

02 6211 P117 120

LICENSE	YEAR	MAK	Œ	MODE		ENGINE	MILEAGE	DATE	IIME
WA-C80157J	2016	Ford Truck	ks F1	50 Pickup	E-p 6-c2	2.7l (164) Turbo	61367	5/23/2019	01:23 PM
V	FHICLE	MAINTEN	ANCE SCH	HEDUI F			SERVICES	COMPLETED	
RECOMMEN			DATE		IILEAGE DUE	Full Service		00000 22722	42.95
Cooling System Engine Oil*			72 months 6 months	eve	ery 100000 ery 5000	1.0 - M9015 Premium -Oi 5.0 - GTX530	I Filters		8.00
Front Differential Rear Differential			See Recs. See Recs.		e Recs. e Recs.	Premium -Oi	il		2.55
Transfer Case*					ery 60000	Parts - 1 - 315	-GTX530 @ 4.95 57 - Bulbs		4.95 3.00
						Environment F			2.65
				108					
			-	"he k."					
		CHECK	LIST		KW E.T.				
CHECKL	IST ITEM	VI		STATU	JS	]		36	
						1			
			1				MA	PY	
			1					Man -	
							90		
	- 4								
						-			
						SUBTOTAL			
MANAGER: T			L ECH: Marlin		open 1				64.10
					OPER:1	TAX (PST)			5.52
COURTESYSamuel		LOWER TO	ECH: Marlin		T/V: 9				
SERVICE REMAI	RKS:					TOTAL			69.62
						AMOUNT	(Fleet Charge	e, 6000)	69.62
						TENDERED			.00
						CHANGE	***NEXT SCH	EDULED VISIT***	
						it - it	HEAT GOTT	LOULD TIGHT	
				- 1		25 05 -			
We guarantee all our p the first opportunity to						13 / 22 - 4-1 V 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			
service packages inclu	ide both pai	rts and labor.			,				
I certify that all work has	been perfor	med satisfacto		ANAGER'S SI	GNATURE	<u>X</u>	CUSTOME	ER SIGNATURE	



73457(REPRINT)

J.r. Hayes And Sons P117 22430 Se 231st Maple Valley, WA 98038 425-392-5722 02 6211 P117 120

LICENSE	YEAR	MAKE	MC	DDEL		ENGINE	MILEAGE	DATE	TIME
WA-C80157J		Ford Trucks	F150 Pic	kup	E-p 6-c 2.	7l (164) Turbo	54838	3/20/2019	01:17 PM
	VEHICLE!	 MAINTENAN	CE SCHEDU	LE		SHOW THE DECK	SERVICES	COMPLETED	
RECOMME			DATE DUE		AGE DUE	Full Service			42.95
Cooling System	NDED SEF		months	every 10		1.0 - M9015			0.00
Engine Oil*		6 m	nonths	every 50	000	Premium -Oil 5.0 - GTX530			8.00
Front Differential Rear Differential			e Recs. e Recs.	See Rec		Premium -Oil			2.55
Transfer Case				every 60		Extra 1.00 - Environment Fo	GTX530 @ 4.95		4,95 2,65
						Ziiviioiiiiioiici	00 (1)		2.00
				e leich	5				
		CHECK LI	ST						
CHECK	LIST ITEM			ATUS					
						6			
						(	5(())	26	
							U	11	2
								4	
		0							
	(19)								
						SUBTOTAL			
MANAGER: <sup>T</sup>		UPPER TECH:	Marlin	OPE	1	(507)			61.10 5.26
COURTESYSamue	el	LOWER TECH:		T/V:	- 1	TAX (PST)			
SERVICE REMA		LOTTE TEOR	St. (d. 71) and			TOTAL			66.36
						AMOUNT	(Fleet Charge,	6000)	66.36
						TENDERED	,	,	.00.
						CHANGE	********	DILL ED MOITH	, III
							""NEXT SCHE	DULED VISIT***	
					10 10 10				
				KALLENGE	RIGHT AND				
Ve guarantee all our ne first opportunity t ervice packages inc	lo correct the	problem in order							

Rock Creek Lube Center 26157 Maple Viy Hwy SE MAPLE VALLEY, WA, 98038

425-413-0165

J.r. Hayes And Sons P117 22430 Se 231st Maple Valley, WA 98038 425-392-5722

# 12-14-18 71819(REPRINT)

WA-C80157J	2016	Ford Trucks	F150 Pickup	E-p	6-c 2.7l (164) Turbo 4	7634 12/13/2018	10:17 AM
					Full Service		42.95
Cooling System Engine Oil* Front Differential		72 mor 6 mont See Re	hs every	100000	1.0 - M9015 Oil Filters Premium -Oil Filters 5.0 - MAG530 Oil		8.00
Rear Differential Transfer Case		See Re	ecs. See I		Premium -Oil Extra 1.00 -MAG530 @ Environment Fee (T)	D 7.95	24.00 7.95 2.65

02 6211 P117 120




T Samuel	Marlin Marlin	1	(PST)	85.55 7.36
				92.91
			(Fleet Charge, 6000)	92.91
				00



LICENSE	YEAR			MODEL		ENGINE	MILEAGE	DATE	TIME
NA-C80157J	2016	Ford Trucks	F150 F	Pickup	E-p 6-c2	.7I (164) Turbo	41254	10/3/2018	02:04 PM
	VEHICLE	MAINITENIA	NCE SCHEE	)   E			050,050	COMPLETES	
RECOMME			DATE DU		AGE DUE	Full Service		COMPLETED	42.95
Cooling System	NOLD SE		2 months	every 10		1.0 - M90	15 Oil Filters		
Engine Oil*		6	months	every 50	000	Premium 5.0 - MAG	-Oil Filters		8.00
Front Differential Rear Differential			ee Recs. ee Recs.	\$ee Re		Premium	-Oil		24.00
Transfer Case				every 6		Extra 1 Environme	.00 -MAG530 @ 7.95		7.95 2.65
									2.00
(1) S		1. 11							
a rual -		CHECK	LIST						
CHECK	KLIST ITE	М	(	STATUS			•	. 0	
						02	6211911	7120	
							· Oon i	•	
		ľ							
		- 1							
					10				
					100				
					-				
						CURTOTAL			
		UPPER TEC	Modin			SUBTOTAL			85.55
MANAGER T		UPPER TEC	H: Manin	OPI	ER:1	TAX (PS	T)		7.36
MANAGER:T									
	el	LOWER TECI	H: Marlin	T/V	: 5	Manager 194			
OURTESYSamue			H: Marlin	T/V		TOTAL			92.91
OURTESYSamue			H: Marlin	T/V		AMOUNT	(Fleet Charge,	6000)	92.91 92.91
OURTESY\$amue			H: Marlin	T/V		AMOUNT TENDERED	(Fleet Charge,	6000)	92.91
OURTESYSamue			H: Marlin	T/V		AMOUNT			92.91
MANAGER: T COURTESYSamue SERVICE REMA			H: Marlin	T/V		AMOUNT TENDERED		6000) DULED VISIT***	92.91
COURTESYSamue	ARKS:	LOWER TEC				AMOUNT TENDERED			
COURTESYSamue  ERVICE REMA	ARKS:	LOWER TECI	ou do have a pr	oblem, we m	ust be given	AMOUNT TENDERED			92.91
OURTESYSamue <b>ERVICE REM/</b>	parts and wo	orkmanship. If y problem in orders and labor.	ou do have a pr er for us to assu	oblem, we m	ust be given	AMOUNT TENDERED			92.91







LICENSE	YEAR	MAH			DEL		NGINE		ILEAGE	DATE	TIME
		Ford Trucks F150 Pick				2.7l (164) Turbo		75972	11/18/2019	11:28 AM	
			IANCE SCI				Full Cod 1		SERVICES	COMPLETED	
RECOMME Cooling System	NDED SE	RVICE	DATE I		MILEAGE every 100000			15 Oil Filte	ers		45.95
Engine Oil*			6 months	- 5	every 5000		Premium 5.0 - GTX	-Oil Filters			8.00
Front Differential Rear Differential	Front Differential Se				See Recs. See Recs.		Premium	-Oil			2.55
Transfer Case*	See Recs.		every 60000		Extra 1. Environme	.00 -GTX53	0 @ 4.95		4.95 2.65		
								00 (1)			2.03
					18						
		CHECK	LIST								
CHECK	KLIST ITEM	VI		STA	ATUS	н					
						Į.					
										19	ē
			,								
									0		
									(C)	)	
									0	3	
						1			((		
										N N	
										15	
		10									
						!	SUBTOTAL				64.10
ANAGER:		UPPER TE	CH: Marlin		OPER:	-	TAX (PS)	Γ)			5.52
OURTESY Samue	el .		:CH: Marlin		T/V: 11						
ERVICE REM			7		<sup>4</sup> va Sam <sup>2</sup>		TOTAL				69.62
					REAL PROPERTY.			71	leet Charge,	6000)	69.62
					الراة بالإيل	1	MOUNT	×,	.oot onaige,	3330)	.00
						C	CHANGE				.00
							1 2	***	EXT SCHE	DULED VISIT***	2
e guarantee all our											
e first opportunity t rvice packages inc			rder for us to	assume	responsibility.	All our					
ertify that all work ha			rily				X				
			MA	ANAGER'S	S SIGNATURE				CUSTOMER	SIGNATURE	



81669(REPRINT)

J.r. Hayes And Sons P117 22430 Se 231st Maple Valley, WA 98038 425-392-5722 02 6211 9117 120

LICENSE	YEAR	MAKE	I M	ODEL		ENGINE	MILEAGE	DATE	TIME
WA-C80157J		Ford Trucks	F150 Pic			7l (164) Turbo	96560	6/23/2020	09:58 Al
	VEHICLE	MAINTENAN	ICE SCHEDU	JLE			SERVICES	COMPLETED	
RECOMME	NDED SER	RVICE	DATE DUE	MILEAG	E DUE	Full Service			45.9
Cooling System	System /2 mon		/2 months every 100000		000	1.0 - M9015 Premium -Oil			9.0
Engine Oil*			nonths	every 5000		5.0 - GTX530			8.0
Front Differential Rear Differential			e Recs. e Recs.	See Recs. See Recs.		Premium -Oil			2.5
Transfer Case*		Pe	e necs.	every 6000	0		GTX530 @ 4.95		4.9
		1				Environment F	ee (T)		2.6
		100		A IS					
		CHECK L	ICT						
CHECK	KLIST ITEN			TATUS					
OFFICE	CLIOT IT LI			71100					
			,	A -					
			- (	1	10				
			//			SIL			
		į.				1			
					U	11			
		i							
		ı							
		i i							
						27			
					-				
					-				
					-				
						SURTOTAL			
			Marlin		4	SUBTOTAL			64.10
1ANAGER: <sup>T</sup>	- 201	UPPER TECH	ı: Marlin	OPER	1	(DCT)			
	el								
OURTESY Samue		UPPER TECH		OPER T/V:		TAX (PST)			5.52
COURTESY Samue	ARKS:	LOWER TECH	Marlin			(DCT)			64.10 5.52 69.62
OURTESY Samue	ARKS:		Marlin			TAX (PST)  TOTAL  AMOUNT	(Fleet Charge,	6000)	5.52 69.62
OURTESY: Samue	ARKS:	LOWER TECH	Marlin			TAX (PST)	(Fleet Charge,	6000)	69.62 69.62
OURTESY: Samue	ARKS:	LOWER TECH	Marlin			TAX (PST)  TOTAL  AMOUNT			69.62 69.62
OURTESY Samue	ARKS:	LOWER TECH	Marlin			TAX (PST)  TOTAL  AMOUNT TENDERED		6000)  DULED VISIT***	5.52 69.62 69.62
COURTESY Samue	ARKS:	LOWER TECH	Marlin			TAX (PST)  TOTAL  AMOUNT TENDERED			5.52
	ARKS: Life- 90% F	LOWER TECH	n: Marlin	T/V:	14	TAX (PST)  TOTAL  AMOUNT TENDERED			5.52 69.62 69.62
ERVICE REM Brake	ARKS: Life- 90% F	ront, 40% Rea	n 06/23/20	T/V:	14 be given	TAX (PST)  TOTAL  AMOUNT TENDERED			69.62 69.62
COURTESY Samue	ARKS: Life- 90% F	ront, 40% Rea	n 06/23/20	T/V:	14 be given	TAX (PST)  TOTAL  AMOUNT TENDERED			69.62 69.62
OURTESY Samue ERVICE REM Brake	ARKS: Life- 90% F  r parts and wo to correct the clude both part	ront, 40% Rea	ou do have a pro	T/V:	be given ty. All our	TAX (PST)  TOTAL  AMOUNT TENDERED	***NEXT SCHE		5.55 69.63 69.63

Rock Creek Lube Center D2 6211 P117 120 FAC 26157 Maple Vly Hwy SE MAPLE VALLEY, WA, 98038 425-413-0165

80687(REPRINT)

INVOICE

LICENSE	YEAR	MAK		DDEL		ENGINE	MILEAGE	DATE	TIME
WA-C80157J	2016	Ford Truck	s F150 Pic	kup	E-p 6-c 2.	7l (164) Turbo	89853	4/13/2020	12:08 PM
	VEHICLE	MAINTEN	ANCE SCHEDU	n E	ļ.,		SERVICES	COMPLETED	NEW COLUMN
			DATE DUE		GE DUE	Full Service			45.95
Cooling System			72 months every 100000			1.0 - M9015 Premium -O			8.00
Engine Oil* Front Differential			6 months See Recs.	every 500 See Recs		5.0 - GTX53	0 Oil		
Rear Differential			See Recs.	See Recs		Premium -O	il -GTX530 @ 4.95		2.55 4.95
Transfer Case*				every 600	000	Parts - 1 - A28	883 - Air Filter		21.95
						Environment I	Fee (T)		2.65
			A		1 '				
					7.7				
		CHECK	CLIST				121		
CHECI	KLIST ITEI			ATUS					
4000									
	4.1								
(	2								
CC	110	1							
	10	10							
		1							
	5								
		5							
				14		SUBTOTAL			86.05
ANAGER:		UPPER TE	ECH: Marlin	OPE	R!	TAX (PST)			7.41
COURTESY <sup>Samue</sup>	el		ECH: Marlin	T/V:	13	ION			
SERVICE REM		LOWER I	-011.	17 V.		TOTAL			93.46
PHAINE HEM	AIIIO.				130		(Fleet Charge	6000)	93.46
					- 2	AMOUNT TENDERED	(Fieet Charge	, 0000)	.00
					1	CHANGE			.00
					77		***NEXT SCH	EDULED VISIT***	The North Control
					i i gián				
Ne guarantee all o	ır narte and "	orkmanehin	If you do have a prol	nlem we mi	ist he diven				
		problem in o	order for us to assum			B I THE I	70 00 00		MARIE LAST
									*7
he first opportunity ervice packages in certify that all work h	-					X			

79479(REPRINT)

J.r. Hayes And Sons P117 22430 Se 231st Maple Valley, WA 98038 425-392-5722

02 6211 P117 120


LICENSE	YEAR			MODEL		ENGINE	MILEAGE	DATE	TIME
WA-C80157J	2016	Ford Truc	ks F150 Pickup E		E-p 6-c 2.	7l (164) Turbo	81994	1/24/2020	11:15 AM
	VEHICLE	MAINITE	NANCE SCHEE	III E			SERVICES	COMPLETED	
					GE DUE	Full Service	CENTIOLS	JOHN LETED	45.95
RECOMMENDED SERVICE Cooling System Engine Oil* Front Differential Rear Differential Fransfer Case*		72 months every 100 6 months every 500 See Recs. See Recs. See Recs. See Recsevery 600		0000 00 s. s.	1.0 - M9015 ( Premium -Oil 5.0 - GTX530 Premium -Oil	Filters Oil GTX530 @ 4.95	8.00 2.55 4.95 2.65		
						Environment	56 (1)		2.03
A UTER		CHEC	K LIST						
CHECK	KLIST ITE			STATUS					
		(	<b>C</b> O/	A.					
						SUBTOTAL			
MANAGER: <sup>T</sup>			TECH: Marlin	OPE	1	(DOT)			
		UPPER T	ECH: Marlin	OPE	:n:1				
COURTESYSamue		UPPER T			:n:1	(DOT)			64.10 5.52 69.62
COURTESYSamue		UPPER T	ECH: Marlin	OPE	:R <sup>1</sup> 12	TAX (PST)  TOTAL	(Fleet Charge	o, 6000)	5.52
OURTESYSamue		UPPER T	ECH: Marlin	OPE	:R. <sup>1</sup> 12	TAX (PST)  TOTAL  AMOUNT TENDERED	(Fleet Charge	s, 6000)	5.52 69.62 69.62
COURTESY <sup>SAMUE</sup>	ARKS:	UPPER T	ECH: Marlin	OPE T/V:	:R <sup>1</sup> 12	TAX (PST)  TOTAL		e, 6000)	69.62 69.00
COURTES (Samue)  SERVICE REM.  Ve guarantee all oune first opportunity	ARKS:	UPPER T LOWER T	ECH: Marlin ECH: Marlin	OPE T/V:	ER. <sup>1</sup> 12 ust be given	TAX (PST)  TOTAL  AMOUNT TENDERED			69.62 69.00
MANAGER: T COURTESYSAMUS SERVICE REMA  We guarantee all outhe first opportunity ervice packages incoming that all work his	r parts and w	UPPER T LOWER T	If you do have a porder for us to assister.	OPE T/V:	:R <sup>1</sup> 12 ust be given bility. All our	TAX (PST)  TOTAL  AMOUNT TENDERED	***NEXT SCH		69.62 69.62 .00

#### ANY ADDITIONAL COMMENTS OK 🔽 📗 ADDITIONAL COMMENTS Comments: UNDER VEHICLE INSPECTION OK V SHOCKS / STRUTS Comments: STEERING LINKAGE COMPONENTS OK 🗸 SUSPENSION COMPONENTS AND BALL OK 🔽 **JOINTS** Comments: OK 🗾 📕 EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION DRIVE SHAFT UNIVERSAL JOINTS AND OK 🗸 CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION Comments: SEVERE OIL ENGINE OIL, COOLANT LEAKS, OR A/C **LEAKS** Comments: AC COMPRESSOR AND TXV, DESICANT BAG NEED REPLACING TRANSMISSION / AWD FLUID LEAKS OK V Comments OK V DRIVE AXLE LEAKS POWER STEERING FLUID LEAKS OK V OIL CHANGE REMINDERS YES 🔽 RESET OIL CHANGE REMINDER NEW LUBE STICKER FOR WINDSHIELD YES 🗸 RETRAIN TPMS AFTER TIRE ROTATE - IF YES 🗸 **REQUIRED BRAKES** BRAKES NOT CHECKED ON THIS VISIT Comments: 6MM OR LEFT FRONT BRAKE PAD THICKNESS Comments: 8MM 6MM OR RIGHT FRONT BRAKE PAD THICKNESS Comments: 8MM LEFT REAR BRAKE PAD THICKNESS 6MM OR Comments: 7MM RIGHT REAR BRAKE PAD THICKNESS 6MM OR Comments: 7MM

1. St 5 - 1.2

**Fugate Ford** P.O. BOX 217

ENUMCLAW, WA, 98022



OK 🔽

OK V

OK V

OK 🗾

N/A

OK V

OK 🗸

OK 🔽

7/32 OR 🗸

7/32 OR 🗸 📉

REQUIRES

#### Customer

Name JR HAYES CONSTRUCTION

Address

22430 SE 231 ST MAPLE VALLEY, WA

City Zip Code

98038

PhoneNumber (206) 379-7054(c)

Email

mandrosko@jrhayes.com

# Inspection

Service Order

447835

Advisor

Vince Swanson

Tech

Jim Ellison

#### LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS.

BRAKE LIGHTS AND TURN SIGNALS

· No Comments:

# WINDSHIELD WIPER OPERATION

WINDSHIELD WIPER AND WASHER

OK V

OK V

SQUIRTER OPERATION

WINDSHIELD WIPER BLADES

OK 🔽

Comments:

Comments:

#### HORN

HORN OPERATION

OK 🔽

Comments:

#### WARNING LIGHTS

WARNING LIGHTS ON THE DASH

OK V

Comments:

#### **BATTERY**

BATTERY COLD CRANKING AMPS

OK 🔽

Comments:

Comments:

BATTERY CABLES AND TERMINAL CORROSION

OK 🔽



#### Vehicle

VIN 1FTMF1EP1HKD60387 2017

**FORD** 

Year

Make

Model F-150

**Engine** 

2.7L V6 ECOBOOST

10/29/2020 10:44:04 AM

Fuel

Stock Number

License/Stock C80157J

Date In

Completed Date

Odom 108628

## UNDER HOOD INSPECTION

ENGINE OIL LEVEL AND CONDITION

Comments:

ENGINE COOLANT LEVEL AND

CONDITION

Comments:

ENGINE COOLING SYSTEM HOSES,

RADIATOR VISUAL INSPECTION

Comments:

TRANSMISSION FLUID LEVEL AND CONDITION (IF EQUIPPED WITH A DIPSITCK)

Comments:

POWER STEERING FLUID LEVEL AND CONDITION

Comments:

BRAKE FLUID LEVEL AND CONDITION

ENGINE AIR FILTER CONDITION

Comments: NEEDS NEW

SERPENTINE BELT CONDITION

Comments:

# **TIRES**

ALIGNMENT CHECK OR WHEEL

**BALANCE NEEDED** 

LEFT FRONT TIRE TREAD DEPTH / WEAR PATTERN

Comments: 14/32

RIGHT FRONT TIRE TREAD DEPTH / WEAR PATTERN

Comments:

LEFT REAR TIRE TREAD DEPTH / WEAR PATTERN

Comments: 13/32

RIGHT REAR TIRE TREAD DEPTH / WEAR **PATTERN** 

Comments:

TIRE PRESSURE SET TO FACTORY **SPECS** 

Comments:

7/32 OR 🗸 7/32 OR 🗸

SET TO SPECS



ANY ADDITIONAL COMME	ENTS		N.
ADDITIONAL COMMENTS	ок	1	
Comments:			
UNDER VEHICLE INSPEC	TION		
SHOCKS / STRUTS	OK	1	
Comments:			
STEERING LINKAGE COMPONENTS	ОК	/	
Comments:			
SUSPENSION COMPONENTS AND BALL JOINTS	OK		
Comments:			
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	OK		
Comments:			
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION	OK	<b>V</b>	
Comments:	OV	- 2	
ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK	<b>V</b>	
Comments:			· 8=
TRANSMISSION / AWD FLUID LEAKS	OK	V	
DRIVE AXLE LEAKS	OK	.7	
Comments:	OR		
POWER STEERING FLUID LEAKS	OK	1	
Comments:			
OIL CHANGE REMINDERS	3	ļ	
RESET OIL CHANGE REMINDER	YES	1	
NEW LUBE STICKER FOR WINDSHIELD	YES	1	
RETRAIN TPMS AFTER TIRE ROTATE - IF REQUIRED	YES	<b>/</b>	Щ
BRAKES			
BRAKES NOT CHECKED ON THIS VISIT			
Comments:			
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	1	
Comments: 8MM			
RIGHT FRONT BRAKE PAD THICKNESS	6MM OR	<b>V</b>	
Comments: 8MM	01414.05	10921	
LEFT REAR BRAKE PAD THICKNESS	6MM OR	V	
Comments: 6MM RIGHT REAR BRAKE PAD THICKNESS	6MM OR	1	
Comments: 6MM			
Continents, States			



OK V

OK 🔽

OK 🔽

OK 🔽

OK 🔽

OK 🔽

OK 🗸

#### Customer

Name JR HAYES CONSTRUCTION

Address 22430 SE 231 ST

MAPLE VALLEY, WA City

Zip Code 98038

PhoneNumber (206) 379-7054(c)

Email mandrosko@jrhayes.com

# Inspection

Service Order 452101

Advisor Dixie Thompson

Tech Dakota Lewis

#### LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS,

BRAKE LIGHTS AND TURN SIGNALS

· No Comments:

# WINDSHIELD WIPER OPERATION

WINDSHIELD WIPER AND WASHER

SQUIRTER OPERATION

Comments:

WINDSHIELD WIPER BLADES

Comments:

#### HORN

HORN OPERATION

Comments:

WARNING LIGHTS

WARNING LIGHTS ON THE DASH

Comments:

# **BATTERY**

BATTERY COLD CRANKING AMPS

Comments:

BATTERY CABLES AND TERMINAL

CORROSION

Comments:

# Vehicle

Make

Model

Odom

#### UNDER HOOD INSPECTION

Comments:

CONDITION

Comments:

RADIATOR VISUAL INSPECTION

DIPSITCK)

Comments:

CONDITION

Comments:

BRAKE FLUID LEVEL AND CONDITION

ENGINE AIR FILTER CONDITION

SERPENTINE BELT CONDITION

Comments:

#### TIRES

ALIGNMENT CHECK OR WHEEL

**BALANCE NEEDED** 

Comments:

LEFT FRONT TIRE TREAD DEPTH / WEAR

**PATTERN** 

RIGHT FRONT TIRE TREAD DEPTH /

WEAR PATTERN

Comments: 12/32

Comments: 12/32

LEFT REAR TIRE TREAD DEPTH / WEAR

**PATTERN** Comments: 13/32

RIGHT REAR TIRE TREAD DEPTH / WEAR

**PATTERN** 

Comments: 13/32 TIRE PRESSURE SET TO FACTORY

**SPECS** 

Comments: 35 PSI



OK V

OK V

OK V

7/32 OR 🗸 📄


7/32 OR 🗸 📗

7/32 OR 🗸 📉

SET TO SPECS

7/32 OR 🗸

REQUIRES I

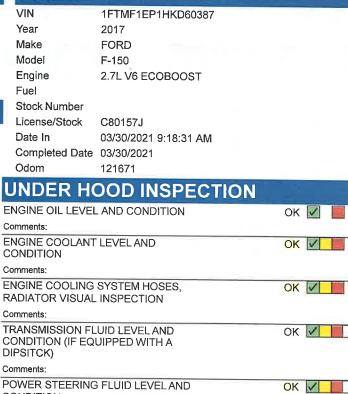

# Rock Creek Lube Center

26157 Maple Vly Hwy SE MAPLE VALLEY, WA, 98038 425-413-0165



INVOICE

87290(REPRINT)

J.r. Hayes And Sons P117 22430 Se 231st Maple Valley, WA 98038 425-392-5722 02 6211 P117 120

LICENSE	YEAR	MAK	E MODEL		MODEL		ENGINE MILEAGE DATE		TIME	
WA-C80157J	2016	Ford Truc	ks F150 Pickup E-p 6-c 2.		E-p 6-c 2.7	7l (164) Turbo	129,568	6/11/2021	08:17 AM	
v	EHICLE	MAINTEN	ANCE SCHED	ULE	hg & and	NEW PLANT	SERVICES	COMPLETED		
RECOMMEN	DED SEF	RVICE	DATE DUE	MILEA	GE DUE	Full Service			52.95	
Engine Oil*	Front Differential Rear Differential		72 Months 6 Months See Recs. See Recs.		aths EVERY 100000 EVERY 5000 ecs. See Recs.		Full Service 1.0 - M9015 Oil Filters Premium -Oil Filters 5.0 - GTX530 Oil Premium -Oil Extra 1.00 -GTX530 @ 4.95 Environment Fee (T)			
		CHECK		Marine 1						
CHECKL	LIST ITEM	Λ	S	TATUS						
	6									
T		<b>,</b> 0	Marlin			SUBTOTAL (PST)			71.10 6.12	
T MANAGER: Samue	el	UPPER TE	Marlin ECH: Marlin	OPE						
IANAGER: Samue		LOWER TE	ECH: Marlin	OPE T/V:	Ri <sub>15</sub>	(PST)				
ANAGER: Samue		LOWER TE	ECH: Marlin		Ri <sub>15</sub>	(PST)	(Fleet Charge, 6	5000)	6.12	
ANAGER: Samue OURTESY: ERVICE REMA	RKS:65%	LOWER TE	ECH: Marlin ECH: rear 6/112021	T/V:	iR 15	TAX		6000) EDULED VISIT***	77.22 77.22 .00	
ANAGER: Samue DURTESY: ERVICE REMA	PKS:65%	front / 25%	ECH: Marlin ECH: rear 6/112021  If you do have a product for us to assu	T/V:	iR 15	TAX  TOTAL  AMOUNT TENDERED			77.22 77.22 .00	

Rock Creek Lube Center

26157 Maple Vly Hwy SE MAPLE VALLEY, WA, 98038 425-413-0165

88730(REPRINT)

(INVOICE)

J.r. Hayes And Sons P117 22430 Se 231st Maple Valley, WA 98038 425-392-5722

026211 P117 120 A

LICENSE	YEAR	25-392-572 MAK		MO	DEL	ALTER AND	ENGINE	MILEAGE	DATE	TIME
WA-C80157J	2016	Ford True								
						Е-р 6-с2.	1 (164) Turbo 137,395 8/30/2021 SERVICES COMPLETED			12:35 PM
	VEHICLE MAINTENANCE SCHEDULE COMMENDED SERVICE DATE DUE				AGE DUE	DIVERSION CAN'T	COMPLETED			
-			To Aller	THE WARRANT OF THE PARTY OF		SEPTEMBER 1	Full Service 1.0 - M9015 (	Dil Filters		55.95
Engine Oil*	Cooling System* Engine Oil* Front Differential			72 Months EVERY 100 6 Months EVERY 500			Premium -Oil 5.0 - GTX530	Filters		8.00
Rear Differentia	al		See Recs		See Rec	≫.	Premium -Oil	GTX530 @ 4.95		2.55 4.95
Transfer Case*					EVERY	60000	Environment Fe			2.65
		CHECK	LICT		Le rec					
CHECKI	LIST ITE		LIST	ST	ATUS					
		*	1					$C_{0}$		
		#						CO/	N/S	
								U	11	
¥									-	
		8								
		in.								
-							CURTOTAL			74.10
ANAGER: Samu		UPPER TE	Marlin		OBE	·n.	SUBTOTAL (PST)			6.45
Odino	iel		Within	1	T/V:		TAX			
OURTESY:	<b>GRINGS</b> 155-6	LOWER TE		turio.	17V.	CHILD IN SHIP	TOTAL		1000	80.55
				1			AMOUNT	(Fleet Charge, 6	8000)	<b>80.55</b>
Br	alles	1					TENDERED			
					400		CHANGE	***NEXT SCHI	DULED VISIT***	
e guarantee all our p	parts and w	orkmanship. I	f you do hav	e a probl	em, we mu	ıst be given		11/		
e first opportunity to rvice packages inclu			rder for us to	assume	responsib	oility. All our	(1	1/1/11	0117	<del></del>
ertify that all work has	been perfor	med satisfacto		AANAGED	'S SIGNATU	IDE (	$\times$ $\sim$	CUSTOME	R SIGNATURE	



Fugate Ford P.O. BOX 217 ENUMCLAW, WA, 98022





#### Customer

Name

JR HAYES CONSTRUCTION

Address

22430 SE 231 ST

City

MAPLE VALLEY, WA

Zip Code

98038

PhoneNumber

(206) 379-7054(c)

Email

mandrosko@jrhayes.com

## Inspection

Service Order

456589

Advisor

Vince Swanson

Tech

**GARY MCREYNOLDS** 

#### LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS, BRAKE LIGHTS AND TURN SIGNALS

OK 🗸 📗

OK V

Comments:

WINDSHIELD WIPER OPERATION

WINDSHIELD WIPER AND WASHER

SQUIRTER OPERATION

Comments:

WINDSHIELD WIPER BLADES

OK V

#### Comments: HORN

HORN OPERATION

OK 🗸

Comments:

#### WARNING LIGHTS

WARNING LIGHTS ON THE DASH

OK 🗸

Comments:

## BATTERY

BATTERY COLD CRANKING AMPS

OK 🗸

Comments:

Comments:

BATTERY CABLES AND TERMINAL

CORROSION

OK V

#### Vehicle

VIN 1FTMF1EP1HKD60387

Year

2017

Make

**FORD** F-150

Model

2.7L V6 ECOBOOST

Engine Fuel

Stock Number

License/Stock C80157J

09/02/2021 1:39:31 PM Date In

Completed Date

Odom 137666

# UNDER HOOD INSPECTION

ENGINE OIL LEVEL AND CONDITION

OK V



ENGINE COOLANT LEVEL AND

CONDITION

ENGINE COOLING SYSTEM HOSES, RADIATOR VISUAL INSPECTION

OK V

OK V



Comments

TRANSMISSION FLUID LEVEL AND CONDITION (IF EQUIPPED WITH A DIPSITCK)



Comments

POWER STEERING FLUID LEVEL AND CONDITION



OK V



BRAKE FLUID LEVEL AND CONDITION

**ENGINE AIR FILTER CONDITION** 

OK



SERPENTINE BELT CONDITION



# TIRES ALIGNMENT CHECK OR WHEEL



7/32 OR



LEFT FRONT TIRE TREAD DEPTH / WEAR

**BALANCE NEEDED** 

Comments

PATTERN Comments RIGHT FRONT TIRE TREAD DEPTH /



WEAR PATTERN

Comments:

**PATTERN** Comments:

LEFT REAR TIRE TREAD DEPTH / WEAR PATTERN

RIGHT REAR TIRE TREAD DEPTH / WEAR

TIRE PRESSURE SET TO FACTORY

7/32 OR

7/32 OR 🗸 📉

SET TO SPECS



**SPECS** Comments

		-
CTION		
OK	1	
OK	1	
OK	<b>V</b>	
OK	<b>V</b>	
OK	<b>V</b>	
OK	<b>V</b>	
OK	1	
014		
OK	V	water.
NI/A		
IN/A	100	V
S	A)	5
6MM OR	1	
		111 247
6MM OR	1	
BMM OR LESS		1
BMM OR LESS		1
	OK O	OK V

Fugate Ford P.O. BOX 217

ENUMCLAW, WA, 98022

OK V

OK V

OK V

N/A

OK V

OK V

7/32 OR 🗸 📗

7/32 OR 🗸

7/32 OR 🗸

7/32 OR 🗸

SET TO SPECS V

Do De BEQUIRES

OK V

OK V

#### Customer

Name

JR HAYES CONSTRUCTION

Address

22430 SE 231 ST

City

MAPLE VALLEY, WA

Zip Code

98038

PhoneNumber (206) 379-7054(c)

mandrosko@jrhayes.com Email

#### Inspection

Service Order

458307

Advisor

Vince Swanson

Tech

RICHARD PADGETT

## LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS,

BRAKE LIGHTS AND TURN SIGNALS

Comments:

## WINDSHIELD WIPER OPERATION

WINDSHIELD WIPER AND WASHER

SQUIRTER OPERATION

Comments:

WINDSHIELD WIPER BLADES

Comments:

#### HORN

HORN OPERATION

Comments:

#### WARNING LIGHTS

WARNING LIGHTS ON THE DASH

Comments:

#### **BATTERY**

BATTERY COLD CRANKING AMPS

Comments: 760cca.

BATTERY CABLES AND TERMINAL

CORROSION

Comments:

## Vehicle

VIN 1FTMF1EP1HKD60387

Year

2017 **FORD** 

Make

F-150

Model Engine

2.7L V6 ECOBOOST

Fuel

Stock Number

License/Stock C80157J

Date In 11/03/2021 7:02:00 AM

Completed Date

143091 Odom

## UNDER HOOD INSPECTION

ENGINE OIL LEVEL AND CONDITION

Comments:

OK V

OK V

OK V

OK 🗸

OK V

OK 🗸

OK V

ENGINE COOLANT LEVEL AND

CONDITION Comments: -35

ENGINE COOLING SYSTEM HOSES,

RADIATOR VISUAL INSPECTION

Comments

TRANSMISSION FLUID LEVEL AND CONDITION (IF EQUIPPED WITH A

DIPSITCK)

Comments:

POWER STEERING FLUID LEVEL AND

CONDITION Comments:

BRAKE FLUID LEVEL AND CONDITION

Comments:

**ENGINE AIR FILTER CONDITION** 

Comments: Recomend.

SERPENTINE BELT CONDITION

Comments:

ALIGNMENT CHECK OR WHEEL BALANCE NEEDED

Comments:

LEFT FRONT TIRE TREAD DEPTH / WEAR **PATTERN** 

Comments: 10/32.

RIGHT FRONT TIRE TREAD DEPTH /

WEAR PATTERN

Comments: 10/32 LEFT REAR TIRE TREAD DEPTH / WEAR

**PATTERN** 

Comments: 12/32

RIGHT REAR TIRE TREAD DEPTH / WEAR

**PATTERN** Comments: 12/32,

TIRE PRESSURE SET TO FACTORY

**SPECS** 

Comments: 35psi. Spair 44psi.

ANY ADDITIONAL COMM	ENTS	74
ADDITIONAL COMMENTS		
Comments:	_	
UNDER VEHICLE INSPEC	TION	
SHOCKS / STRUTS	ok <b>✓</b>	
Comments:		
STEERING LINKAGE COMPONENTS	OK 🔣	
Comments:	11.5	
SUSPENSION COMPONENTS AND BALL JOINTS	OK 🔀	
Comments:		
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	OK 🌠	
Comments:		
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION	OK 🗸	
Comments:		
ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK V	
Comments:		
TRANSMISSION / AWD FLUID LEAKS	OK 🔽	
Comments:		
DRIVE AXLE LEAKS		
POWER STEERING FLUID LEAKS	N/A	
Comments:	IVA .	
OIL CHANGE REMINDER	S	
RESET OIL CHANGE REMINDER	YES 🗸	
NEW LUBE STICKER FOR WINDSHIELD	YES V	
RETRAIN TPMS AFTER TIRE ROTATE - IF REQUIRED		
BRAKES		
BRAKES NOT CHECKED ON THIS VISIT		
Comments:		
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	
Comments: 8mm.		
RIGHT FRONT BRAKE PAD THICKNESS	6MM OR	
Comments: 8mm		
LEFT REAR BRAKE PAD THICKNESS	6MM OR	
Comments: 10mm	CMMACD	
RIGHT REAR BRAKE PAD THICKNESS	6MM OR	Tal:
Comments: 10mm		

Fugate Ford P.O. BOX 217

ENUMCLAW, WA, 98022



## Customer

JR HAYES CONSTRUCTION

Address

22430 SE 231 ST MAPLE VALLEY, WA

City Zip Code

98038

PhoneNumber

(206) 379-7054(c)

Email mandrosko@jrhayes.com

## Inspection

Service Order

460886

Advisor

Cary Lindsay

Tech

RICHARD PADGETT

## LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS, BRAKE LIGHTS AND TURN SIGNALS

## WINDSHIELD WIPER OPPERATION

WINDSHIELD WIPER AND WASHER SQUIRTER OPERATION

OK 🔽

Comments:

WINDSHIELD WIPER BLADES

OK V

OK V

Comments:

#### HORN

HORN OPERATION

OK 📝

Comments:

### WARNING LIGHTS

WARNING LIGHTS ON THE DASH

ок 🗹

Comments:

#### **BATTERY**

LEFT BATTERY COLD CRANKING AMPS



Comments:

RIGHT BATTERY COLD CRANKING AMPS

OK V

Comments: Rating 760cca. Test at 760cca.

BATTERY CABLE AND TERMINAL

OK 🕢 📗

CORROSION Comments:

Vehicle

VIN

1FTMF1EP1HKD60387

Year

2017

Make

**FORD** 

Model

Fuel

F-150 2.7L V6 ECOBOOST

Engine

Stock Number

License/Stock C80157J

Date In 02/09/2022 7:31:17 AM

Odom

CONDITION

Comments:

Comments:

DIPSTICK)

CONDITION

**ENGINE AIR FILTER** 

Comments:

Comments:

Completed Date

149688

### **UNDER HOOD**

ENGINE OIL LEVEL AND CONDITION

ENGINE COOLING SYSTEM HOSES AND

ENGINE COOLANT LEVEL AND

RADIATOR VISUAL INSPECTION

TRANSMISSION FLUID LEVEL AND

CONDITION (IF EQUIPPED WITH A

POWER STEERING FLUID LEVEL AND

BRAKE FLUID LEVEL AND CONDITION

OK 🔽



OK 🗸 📗

OK V

OK 🖊 📗

N/A

OK V

OK 🗸

		_	
TIRES			
ALIGNMENT CHECK OR WHEEL BALANCE NEEDED	ОК	1	
Comments:			
LEFT FRONT TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	1	
Comments: 10/32,			
RIGHT FRONT TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	1	
Comments: 10/32,			
LEFT REAR TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	1	
Comments: 10/32.			
WEAR PATTERN (DRW ONLY)	N/A		V
Comments:			
RIGHT REAR TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	<b>V</b>	
Comments: 9/32 RIGHT REAR INNER TIRE DEPTH / WEAR	NI/A		
PATTERN (DRW ONLY)	N/A		V
Comments: TIRE PRESSURE SET TO FACTORY	OFT TO OBEOO	100	
SPECS	SET TO SPECS	A	
Comments: All 4 35psi. Spair 44psi.			
ANY ADDITIONAL COM	MENTS	ď	
ADDITIONAL COMMENTS	REQUIRES		1
Comments: Wind shield is cracked pasenger side.			
BRAKES			Jan.
BRAKES NOT CHECKED AT THIS VISIT			T
Comments:			
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	1	
LEFT FRONT BRAKE PAD THICKNESS Comments: 7mm.	6MM OR	<b>V</b>	
	6MM OR	✓ ✓	
Comments: 7mm.		<b>V</b>	
Comments: 7mm. RIGHT FRONT BRAKE PAD THICKNESS		V	
Comments: 7mm.  RIGHT FRONT BRAKE PAD THICKNESS  Comments: 7mm.	6MM OR	V V	
Comments: 7mm.  RIGHT FRONT BRAKE PAD THICKNESS  Comments: 7mm.  LEFT REAR BRAKE PAD THICKNESS	6MM OR	V V	
Comments: 7mm.  RIGHT FRONT BRAKE PAD THICKNESS Comments: 7mm.  LEFT REAR BRAKE PAD THICKNESS Comments: 9mm.	6MM OR	V V	
Comments: 7mm.  RIGHT FRONT BRAKE PAD THICKNESS Comments: 7mm.  LEFT REAR BRAKE PAD THICKNESS Comments: 9mm.  RIGHT REAR BRAKE PAD THICKNESS	6MM OR 6MM OR	V V	
Comments: 7mm.  RIGHT FRONT BRAKE PAD THICKNESS Comments: 7mm.  LEFT REAR BRAKE PAD THICKNESS Comments: 9mm.  RIGHT REAR BRAKE PAD THICKNESS Comments: 9mm.  OIL CHANGE REMINDE RESET OIL CHANGE REMINDER	6MM OR 6MM OR 6MM OR	<b>V</b>	
Comments: 7mm.  RIGHT FRONT BRAKE PAD THICKNESS  Comments: 7mm.  LEFT REAR BRAKE PAD THICKNESS  Comments: 9mm.  RIGHT REAR BRAKE PAD THICKNESS  Comments: 9mm.  OIL CHANGE REMINDE	6MM OR 6MM OR	✓ ✓	

UNDER VEHICLE INSPECT	ION
SHOCKS / STRUTS	OK 🗾
Comments:	
STEERING LINKAGE COMPONENTS	OK 🗸
Comments:	
SUSPENSION COMPONENTS AND BALL JOINTS	OK 🔽 📕
Comments:	
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	OK 🗸 📙
Comments:	
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION	OK 🌠 📙
Comments:	
ENGINE OIL, COOLANT, OR A/C SYSTEM LEAKS	OK V
Comments:	
TRANSMISSION / AWD FLUID LEAKS	OK 🗸
Comments:	
DRIVE AXLE LEAKS	OK V
Comments:	
POWER STEERING FLUID LEAKS	N/A
Comments:	

Fugate Ford P.O. BOX 217

ENUMCLAW, WA, 98022





## Customer

JR HAYES CONSTRUCTION Name

22430 SE 231 ST Address City MAPLE VALLEY, WA

Zip Code 98038

PhoneNumber (206) 379-7054(c) Email mandrosko@jrhayes.com

## <u>Inspection</u>

Service Order 464651

Dixie Thompson Advisor RICHARD PADGETT Tech

#### LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS.

BRAKE LIGHTS AND TURN SIGNALS

Comments:

# WINDSHIELD WIPER OPPERATION

WINDSHIELD WIPER AND WASHER SQUIRTER OPERATION

Comments:

WINDSHIELD WIPER BLADES

Comments:

#### **HORN**

HORN OPERATION

Comments:

#### WARNING LIGHTS

WARNING LIGHTS ON THE DASH

Comments:

### BATTERY

LEFT BATTERY COLD CRANKING AMPS

Comments:

RIGHT BATTERY COLD CRANKING AMPS

Comments: 760cca.

BATTERY CABLE AND TERMINAL CORROSION

Comments:

## Vehicle

VIN 1FTMF1EP1HKD60387

2017 Year **FORD** Make F-150 Model

Engine 2.7L V6 ECOBOOST

Fuel

Stock Number

License/Stock C80157J

Date In 06/15/2022 8:21:11 AM

Completed Date

162283 Odom

## **UNDER HOOD**

ENGINE OIL LEVEL AND CONDITION

Comments:

OK V

OK V

OK 🗸

OK 🔽

OK 🔽

OK 🗸

OK 🗾

ENGINE COOLANT LEVEL AND

CONDITION

Comments: -30.

ENGINE COOLING SYSTEM HOSES AND RADIATOR VISUAL INSPECTION

Comments:

TRANSMISSION FLUID LEVEL AND

CONDITION (IF EQUIPPED WITH A DIPSTICK)

Comments:

POWER STEERING FLUID LEVEL AND

CONDITION

Comments:

BRAKE FLUID LEVEL AND CONDITION

Comments:

**ENGINE AIR FILTER** 

Comments: Needs.

OK 🔽

OK V

OK V

OK V

N/A

OK V

REQUIRES |

TIRES			
ALIGNMENT CHECK OR WHEEL BALANCE NEEDED	OK	1	
Comments:			
LEFT FRONT TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	/	
Comments: 19/32.			
RIGHT FRONT TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	1	
Comments: 19/32.			
LEFT REAR TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	V	
Comments: 19/32.			
LEFT REAR INNER TIRE TREAD DEPTH / WEAR PATTERN (DRW ONLY)	N/A		
Comments:			
RIGHT REAR TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	1	
Comments: 19/32.			
RIGHT REAR INNER TIRE DEPTH / WEAR PATTERN (DRW ONLY)	N/A		,
Comments:		III SI	
TIRE PRESSURE SET TO FACTORY SPECS	SET TO SPECS	V	
Comments: Front 55psi, Back 60psi, Spair 44psi.			
	MENITO	- V	
ANY ADDITIONAL COM			
ADDITIONAL COMMENTS	REQUIRES		
Comments: Needs cabin air filter			_
BRAKES			
BRAKES NOT CHECKED AT THIS VISIT			
Comments:			
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	1	
Comments: 7mm.			
RIGHT FRONT BRAKE PAD THICKNESS  Comments: 7mm.	6MM OR	1	
LEFT REAR BRAKE PAD THICKNESS	6MM OR	1	
Comments: 9mm.	OIVIIVI OIV		
RIGHT REAR BRAKE PAD THICKNESS	6MM OR	1	
Comments: 9mm			
OIL CHANGE REMINDE	RS		Ŋ
RESET OIL CHANGE REMINDER	YES	1	
NEW LUBE STICKER FOR WINDSHIELD	YES	<b>V</b>	
RESET TPMS AFTER TIRE ROTATION - IF REQUIRED	YES	<b>V</b>	

	UNDER VEHICLE INSPI	ECTION	
	SHOCKS / STRUTS	OK	V
	Comments:		
	STEERING LINKAGE COMPONENTS	OK	V
	Comments:		
	SUSPENSION COMPONENTS AND BALL JOINTS	OK	<b>V</b>
	Comments:		
	EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	OK	<b>V</b>
	Comments:	3	
]	DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION	OK	
	Comments:		
Į.	ENGINE OIL, COOLANT, OR A/C SYSTEM LEAKS	STARTING TO	<b>✓</b>
	Comments:		
	TRANSMISSION / AWD FLUID LEAKS	OK	<b>/</b>
l.	Comments:		
	DRIVE AXLE LEAKS	OK	V
el,	Comments:		
	POWER STEERING FLUID LEAKS	N/A	<b>V</b>
	Comments:		

## Customer

Name

J.R. HAYES AND SONS INC

Address

22430 SE 231 ST MAPLE VALLEY, WA

City Zip Code

98038

PhoneNumber

(206) 379-7054(c)

Email

mandrosko@jrhayes.com

## <u>Inspection</u>

Service Order

467212

Advisor

Dixie Thompson

Tech

## LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS, BRAKE LIGHTS AND TURN SIGNALS

ok 🗸 📗

## WINDSHIELD WIPER OPPERATION

WINDSHIELD WIPER AND WASHER SQUIRTER OPERATION



Comments:

WINDSHIELD WIPER BLADES

OK 🗸



Comments: HORN

HORN OPERATION

OK V

# WARNING LIGHTS

WARNING LIGHTS ON THE DASH

OK 🗸

Comments:

Comments:

# BATTERY

LEFT BATTERY COLD CRANKING AMPS



Comments: NA

RIGHT BATTERY COLD CRANKING AMPS

OK 🗸

Comments: 760cca

BATTERY CABLE AND TERMINAL

OK 🗸

CORROSION Comments:

Vehicle

1FTMF1EP1HKD60387 VIN

Year

2017

Make

**FORD** 

Model

F-150

Engine

Date In

Odom

2.7L V6 ECOBOOST

Fuel

Stock Number

License/Stock

C80157J

09/07/2022 7:47:08 AM

Completed Date

169080

## **UNDER HOOD**

ENGINE OIL LEVEL AND CONDITION

OK V

OK V

Comments: ENGINE COOLANT LEVEL AND CONDITION

**ENGINE COOLING SYSTEM HOSES AND** RADIATOR VISUAL INSPECTION

OK V

OK 🖊

Comments:

TRANSMISSION FLUID LEVEL AND CONDITION (IF EQUIPPED WITH A DIPSTICK)

Comments:

POWER STEERING FLUID LEVEL AND CONDITION

N/A

Comments:

BRAKE FLUID LEVEL AND CONDITION

Comments:

Comments: Needs

**ENGINE AIR FILTER** 

REQUIRES

OK V

TIRES			
ALIGNMENT CHECK OR WHEEL BALANCE NEEDED	OK	/	
Comments:			
LEFT FRONT TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	/	
Comments: 18/32			
RIGHT FRONT TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	1	
Comments: 18/32,			
LEFT REAR TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	<b>V</b>	
Comments: 18/32.			
LEFT REAR INNER TIRE TREAD DEPTH / WEAR PATTERN (DRW ONLY)	N/A		V
Comments:			
RIGHT REAR TIRE TREAD DEPTH / WEAR PATTERN	7/32 OR	1	
Comments: 18/32, RIGHT REAR INNER TIRE DEPTH / WEAR	21/4		
PATTERN (DRW ONLY)	N/A		, ·
Comments: TIRE PRESSURE SET TO FACTORY	00000	100	
SPECS	SET TO SPECS	<b>Y</b>	
Comments: All 4 tires 60psi			
ANY ADDITIONAL COM	MENTS		<u> </u>
ADDITIONAL COMMENTS	MENTO		
Comments:			
BRAKES	THE PARTY	W.	
BRAKES NOT CHECKED AT THIS VISIT			T
Comments:			-
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	1	
Comments: 7mm			
RIGHT FRONT BRAKE PAD THICKNESS	6MM OR	1	
Comments: 7mm.			
LEFT REAR BRAKE PAD THICKNESS	6MM OR	1	
Comments: 9mm.			
RIGHT REAR BRAKE PAD THICKNESS	6MM OR	1	
Comments: 9mm			
OIL CHANGE REMINDE	RS		
RESET OIL CHANGE REMINDER	YES	1	
NEW LUBE STICKER FOR WINDSHIELD	YES	/	
RESET TPMS AFTER TIRE ROTATION - IF REQUIRED	YES	1	

	2
<b>UNDER VEHICLE INSPECT</b>	ION
SHOCKS / STRUTS	OK 🗸
Comments:	
STEERING LINKAGE COMPONENTS	OK V
Comments:	
SUSPENSION COMPONENTS AND BALL JOINTS	ok 🔼
Comments:	
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	OK 🔀
Comments:	
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION	OK 🗸
Comments:	
ENGINE OIL, COOLANT, OR A/C SYSTEM LEAKS	OK 🗾
Comments:	
TRANSMISSION / AWD FLUID LEAKS	OK V
Comments:	(4)
DRIVE AXLE LEAKS	OK V
Comments:	
POWER STEERING FLUID LEAKS	N/A
Comments:	



#### Customer

J.R. HAYES AND SONS INC Name

Address 22430 SE 231 ST MAPLE VALLEY, WA City

Zip Code 98038

(206) 379-7054(c) PhoneNumber

maridrosko@jrhayes.com Email

## Inspection

Service Order 468739

Advisor Dixié Thompson

Tech

#### LIGHTS

OPERATION OF EXTERIOR LIGHT BULBS, BRAKE LIGHTS AND TURN SIGNALS

: No

Comments:

## WINDSHIELD WIPER OPERATION

WINDSHIELD WIPER AND WASHER

SQUIRTER OPERATION

Comments:

WINDSHIELD WIPER BLADES

Comments:

### HORN

HORN OPERATION

Comments:

WARNING LIGHTS

WARNING LIGHTS ON THE DASH

Comments:

#### BATTERY

BATTERY COLD CRANKING AMPS

Comments:

BATTERY CABLES AND TERMINAL

CORROSION

Comments:

## Vehicle

VIN 1FTMF1EP1HKD60387

2017 Year FORD Make F-150 Model

Engine 2.7L V6 ECOBOOST

Fuel

Stock Number

License/Stock C80157J

Date In 10/27/2022 10:43:45 AM

Completed Date

Odom 175351



OK V

OK V

N/A

OK V

OK V

OK 🚺

OK V

7/32 OR

7/32 OR

7/32 OR 🗸 📉

7/32 OR

MAY REQUIRE

MAY REQUIRE

### UNDER HOOD INSPECTION

ENGINE OIL LEVEL AND CONDITION

Comments:

OK 🔽

OK 🔽

OK 🗸

OK 🗸

OK 🔽

ок 🔽

OK 🔽

**ENGINE COOLANT LEVEL AND** 

CONDITION

Comments: REC SERVICE

ENGINE COOLING SYSTEM HOSES,

RADIATOR VISUAL INSPECTION

Comments:

TRANSMISSION FLUID LEVEL AND CONDITION (IF EQUIPPED WITH A

DIPSITCK)

Comments: REC SERVCIE POWER STEERING FLUID LEVEL AND

CONDITION

Comments:

BRAKE FLUID LEVEL AND CONDITION

Comments:

ENGINE AIR FILTER CONDITION

Comments:

SERPENTINE BELT CONDITION

Comments:

#### TIRES

ALIGNMENT CHECK OR WHEEL **BALANCE NEEDED** 

Comments:

LEFT FRONT TIRE TREAD DEPTH / WEAR PATTERN

Comments: 17/32

RIGHT FRONT TIRE TREAD DEPTH / WEAR PATTERN

Comments:

LEFT REAR TIRE TREAD DEPTH / WEAR **PATTERN** 

Comments: 17/32

RIGHT REAR TIRE TREAD DEPTH / WEAR **PATTERN** 

Comments:

Comments:

TIRE PRESSURE SET TO FACTORY **SPECS** 



ANY ADDITIONAL COMM	ENTS	
ADDITIONAL COMMENTS	REQUIRES 📗	1
Comments: 100K SZERVICE, DIFFS, TRANSFER CASE, S	SPARK PLUGS, INDUC	TION
UNDER VEHICLE INSPEC	TION	
SHOCKS / STRUTS	OK 🔽	
Comments:		
STEERING LINKAGE COMPONENTS	OK 🗸	
Comments:		
SUSPENSION COMPONENTS AND BALL JOINTS	ok 🔽	
Comments:		
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	OK 🗸	
Comments:		
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION	OK 🗾	
Comments:		
ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK 🔽	
Comments:		
TRANSMISSION / AWD FLUID LEAKS	OK V	
Comments:		
DRIVE AXLE LEAKS	OK V	
Comments:		
POWER STEERING FLUID LEAKS	N/A	<b>/</b>
Comments:		
OIL CHANGE REMINDER	S	
RESET OIL CHANGE REMINDER	YES 🗸	
NEW LUBE STICKER FOR WINDSHIELD	YES 🗸	
RETRAIN TPMS AFTER TIRE ROTATE - IF REQUIRED	YES 🔽	
BRAKES		
BRAKES NOT CHECKED ON THIS VISIT		
Comments:		
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	
Comments: 7MM		
RIGHT FRONT BRAKE PAD THICKNESS	6MM OR 🗹	
Comments:		
LEFT REAR BRAKE PAD THICKNESS	6MM OR 🔽	
Comments: 8MM		
RIGHT REAR BRAKE PAD THICKNESS  Comments:	6MM OR	

Custom	er	45 1 1	Vehicle		
Name	J.R. HAYES AND SONS INC		VIN	1FTMF1EP1HKD60387	
Address	22430 SE 231 ST		Year	2017	
City	MAPLE VALLEY, WA		Make	FORD	
Zip Code	98038		Model	F-150	
PhoneNumber	(206) 379-7054(c)		Engine	2.7L V6 ECOBOOST	
Email	mandrosko@jrhayes.com		Fuel		A
Inspecti	on		Stock Number		1
Service Order	470824		License/Stock		01/1
Advisor	Katie Vick-Fiala		Date In	01/11/2023 7:30:55 AM	/)///
Tech	Natie vick-i iaia		Completed Da		A,
			Odom	180802	1
LIGHTS			UNDER H	HOOD INSPECTI	ON
	F EXTERIOR LIGHT BULBS,	ок 🗾 📕	ENGINE OIL LEV	EL AND CONDITION	ок 🗹 📗
	S AND TURN SIGNALS		Comments:		
: No Comments:			ENGINE COOLA CONDITION	NT LEVEL AND	OK V
<b> WINDS</b>	<b>IIELD WIPER OPER</b>	RATION	Comments:		//
WINDSHIELD V SQUIRTER OP	VIPER AND WASHER ERATION	OK 🔽 📕		NG SYSTEM HOSES, IAL INSPECTION	OK V
Comments:			Comments:		
WINDSHIELD V	WIPER BLADES	OK 🗸		FLUID LEVEL AND	OK 🗸
Comments:			DIPSITCK)	EQUIPPED WITH A	
HORN	1950E   100 E   100 E		Comments:		
HORN OPERAT	TION	ок 🗾 📕	POWER STEERI CONDITION	NG FLUID LEVEL AND	OK V
Comments:			Comments:		
WARNIN	IG LIGHTS		BRAKE FLUID LE	EVEL AND CONDITION	OK V
	HTS ON THE DASH	OK 🗸	Comments:		
Comments:	THE BROTT	OK L	ENGINE AIR FILT	TER CONDITION	REQUIRES 📗 💆
Name of the latest of the late	V		Comments: RECCON	MEND REPLACEMENT, DEALER OU	T OF STOCK 1/11/23.
BATTER	Υ		SERPENTINE BE	ELT CONDITION	OK 🗾 📗
BATTERY COL	D CRANKING AMPS	ok 🗾 📕	Comments:		
Comments:		11	TIRES		THE REPORT
BATTERY CABI CORROSION	LES AND TERMINAL	OK 🔽 📕	ALIGNMENT CHE		OK 🔽 📗
Comments:			BALANCE NEED	LD	
			Comments:  LEFT FRONT TIF PATTERN	RE TREAD DEPTH / WEAR	7/32 OR 🗸
			Comments: 15/23		
				IRE TREAD DEPTH /	7/32 OR 🗸

Comments: 15/23

**PATTERN** Comments: 15/23

**PATTERN** Comments: 15/23

**SPECS** Comments:

LEFT REAR TIRE TREAD DEPTH / WEAR

RIGHT REAR TIRE TREAD DEPTH / WEAR

TIRE PRESSURE SET TO FACTORY

7/32 OR 🗸

7/32 OR 🗸

SET TO SPECS 🗾

ANY ADDITIONAL COMMI	ENTS	
ADDITIONAL COMMENTS	OK 🔽	
Comments:		
UNDER VEHICLE INSPEC	TION	
SHOCKS / STRUTS	ок 🗾	
Comments:		
STEERING LINKAGE COMPONENTS	OK 🗾	
Comments:	***	
SUSPENSION COMPONENTS AND BALL JOINTS	OK 🔽	
Comments:		
EXHAUST LEAKS AND EXHAUST SYSTEM VISUAL INSPECTION	OK 🗾	
Comments:	u-in-	111 - 20
DRIVE SHAFT UNIVERSAL JOINTS AND CONSTANT VELOCITY (CV) BOOTS VISUAL INSPECTION	OK 🗾	
Comments:		
ENGINE OIL, COOLANT LEAKS, OR A/C LEAKS	OK ✓	
Comments:	District	
TRANSMISSION / AWD FLUID LEAKS	OK V	
Comments:	014	
DRIVE AXLE LEAKS	OK V	
POWER STEERING FLUID LEAKS	OK Z	
Comments:	OK 🖊	
OIL CHANGE REMINDERS	5	
RESET OIL CHANGE REMINDER	YES 🗸	
NEW LUBE STICKER FOR WINDSHIELD	YES 🗹	
RETRAIN TPMS AFTER TIRE ROTATE - IF REQUIRED	YES 🗹	
BRAKES		
BRAKES NOT CHECKED ON THIS VISIT		
Comments:		
LEFT FRONT BRAKE PAD THICKNESS	6MM OR	
Comments: 8MM		
RIGHT FRONT BRAKE PAD THICKNESS	6MM OR	
Comments: 8MM	<u> </u>	
LEFT REAR BRAKE PAD THICKNESS	6MM OR	
Comments: 8MM		
RIGHT REAR BRAKE PAD THICKNESS	6MM OR	
Comments: 8MM		